Service Bulletin

COPIER

Issued by Canon Europa N.V.

Model : GP405/335

No.: GP405-011
(FF-T01-J7-000030-01)

DATE: 08.10.99

Location : MAIN UNIT LEFT SIDE PANEL


Subject : INSTALLING MULTI-OUTPUT TRAY-D1

Reason : Upon shipment from the factory, some of the MULTI-OUTPUT TRAY-D1 fixing screws have untapped holes. This is to describe the field fix and countermeasure.

Details : < FIELD FIX >
When mounting the MULTI-OUTPUT TRAY-D1, the hinge (FB4-3791-000: Parts calatogue FY8-31CK-020 Q10-3) is attached to the copier main unit, but due to a mistake during assembly, some were shipped out with screws that have untapped holes. The field fix is as follows:

Remove the RS tight screw that secures the Front Left Cover (FB4-3233) and use it to tap the screw hole in the location shown in the diagram below.

Then, mount the MULTI-OUTPUT TRAY-D1 hinge.

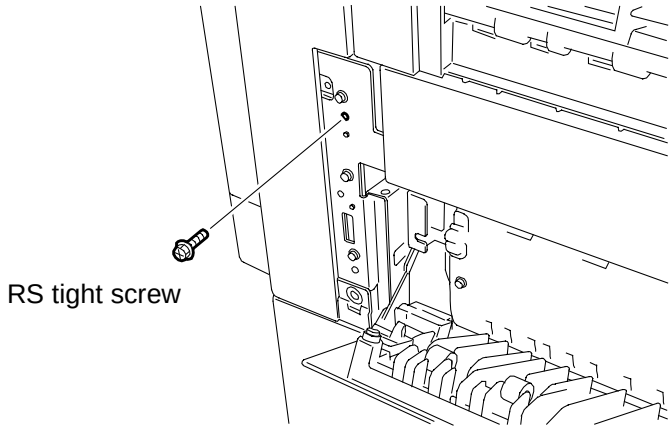

Corresponding machine numbers are as shown below:

PNZ00624~PNZ00679	QNZ03048~QNZ03640	UNZ04619~UNZ05262
PNY00488~PNY00511	QNY02328~QNY02834	UNY04705~UNY05095, UNY04676
NQJ00001~NQJ00691	SNZ01722~SNZ02179	RNZ00822~RNZ00830
NQG00506~NQG02203	SNY01609~SNY01721	PNX00953~PNX01072
TNZ01494~TNZ01623	PNW00791~PNW00998	TNY01038~TNY01198