
(5) C0070: Toner Replenishing Motor's Failure to Turn
C0071: Toner Replenishing Motor Turning at Abnormal Timing

Relevant Electrical Parts	
Toner Bottle Home Position Sensor PC112 Toner Replenishing Motor M8	Master Board PWB-A

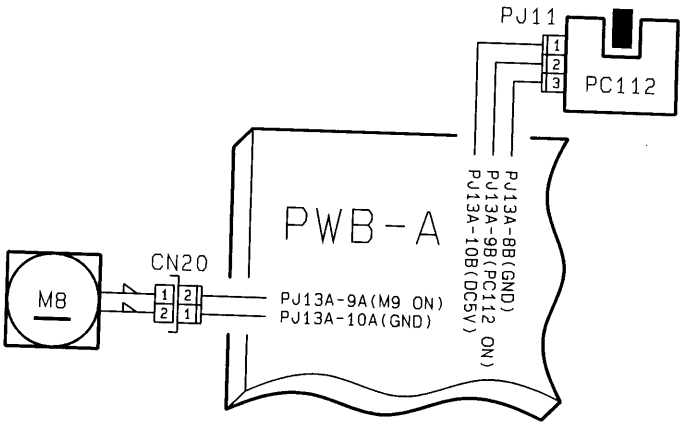

1177C11TAA

C0070

Step	Check	Result	Action
1	Toner Bottle turns when the Toner Bottle is turned a half turn and the Front Door is closed	NO	Correct drive coupling.
2	Toner Bottle Home Position Sensor operation: the voltage across PJ13A-9B on the Master Board and GND is DC0V (Toner Bottle at home position) and DC5V (Toner Bottle at a position other than home) when step 1 is performed.	YES	Change Master Board.
		NO	Change sensor.
3	Toner Replenishing Motor operation: the voltage across PJ13A-9A on the Master Board and GND is DC0V (Toner Bottle at a stop) and DC24V (Toner Bottle turning) when step 1 is performed.	YES	Change motor.
		NO	Change Master Board.

C0071

Step	Check	Result	Action
1	Toner Bottle turns abnormally after the malfunction has been reset	YES	Change Master Board.