
(8) C0600: Scanner Motor Malfunction

Relevant Electrical Parts	
Scanner Motor M5 Scanner Home Sensor PC81	Master Board PWB-A SCP Board PWB-F

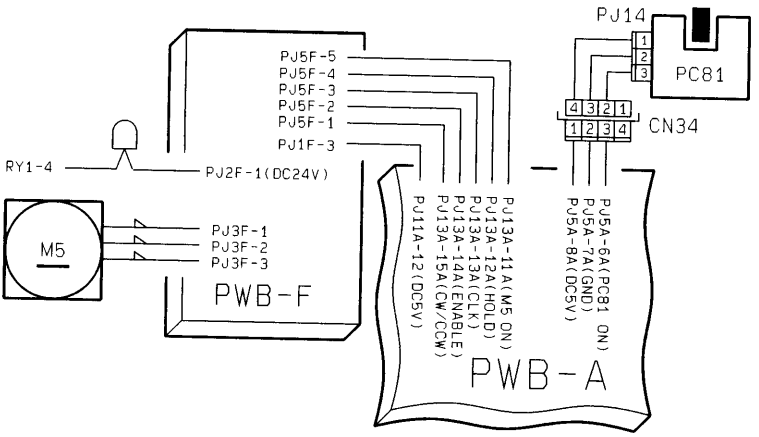

1177C12TAB

C0600

Step	Check	Result	Action
1	Have Scanner motion when it is moved manually.	NO	Correct drive coupling. Rewind cables.
2	Connectors on the SCP Board properly connected	NO	Connect.
3	The voltage across PJ11A-12 on the Master Board and GND is DC5V after the malfunction has been reset.	NO	Change Master Board.
4	The voltage across PJ2F-1 on the SCP Board and GND is DC24V	YES	Change Scanner Motor and SCP Board.
5	Scanner Home Sensor operation: the voltage across PJ5A-6A on the Master Board and GND is DC0V (sensor blocked) and DC5V (sensor unblocked).	YES	Change Master Board.
		NO	Change sensor.