SERVICE BULLETIN

■ PROBLEM	● FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
□ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	○ OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 011
DATE : 981007
SUBJECT : SOFTWARE PROGRAM OF IC70B ON PWB-B CHANGE

The software program of IC70B on P.W. Board-B has been changed and the following problems have been solved. Due to this, the memory program of the memory card IC (01) has been changed.

1. In 2-in-1 copy mode, a void image may appear on the copy at the area of the 2nd original image.
2. If 2-sided copying is done using mixed originals, C1334 or C11F4 may appear on the touch panel erroneously.
3. When copying is restarted after the paper empty condition is solved, C11ED may appear on the touch panel erroneously.
4. Even though the staple empty condition occurs, the empty indication may not appear on the touch panel.
5. A paper size which is different from the selected size may be used for copying.
6. If Letter, A4L or B5L is used for copying, corner stapling may not operate.
7. In the machine equipped with the controller Pi6000:
   1) If a paper empty condition occurs when the paper fed from the drawer is used for printing, the touch panel may indicate that the paper is replenished at the multi bypass tray.
   2) Between setting the copy mode and copy starting, if the data is sent from a PC and the machine is in printer mode for the PC, it is reset to copy mode after the printing is completed.
   3) When data is sent from a PC, C1102 may appear on the touch panel erroneously.

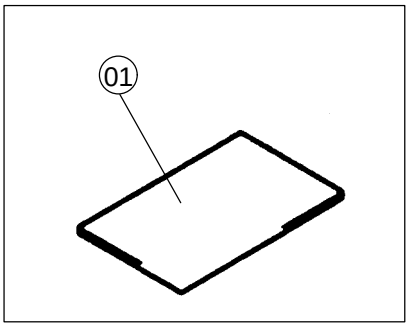

IC70B Version : 10G019-00 ➡ 10G032-00

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →	I	SE/NO.	AREA
01	46-35AA	1155-0753-01	1155-0753-02	46-35AB	JIG MEMORY CARD	1	1 Y	001162	0000