SERVICE BULLETIN

■ PROBLEM	● FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
□ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	○ OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 017
DATE : 981119
SUBJECT : SOFTWARE PROGRAM OF IC70B ON PWB-B CHANGE

The software program of IC70B on P.W. Board-B has been changed and the following problems have been solved. Due to this, the memory program of the memory card (01) has been changed.

1. After all pages of the document are scanned in Separate Scan mode, if copying is done in interrupt mode, the copies may be blank after the interrupt mode is reset.
2. After copying is done in Cover mode with Corner Staple or 2-Point Staple selected, even though the copying is done in Memory Recall mode without a mode change, Staple mode may be reset and changed to Non-Sort mode.
3. In X/Y Zoom mode using a book original, the image may be turned and a void image may appear on the copy.
4. After the time/day card is inserted in the slot of the Data Controller D-102, the time and day may not be set.
5. In the machine equipped with the controller Pi6000:
   1) C1160 may appear on the touch panel erroneously during copying.
   2) C1270 may appear on the touch panel erroneously in OHP Interleaving mode.
   3) C11F9 may appear on the touch panel erroneously in Cover mode when 2-Point Staple or Folding-Crease mode is selected.
   4) In Manual Bypass Copying, the “Exclusive paper” key may not be indicated on the touch panel or the “Exclusive paper” key may not operate.

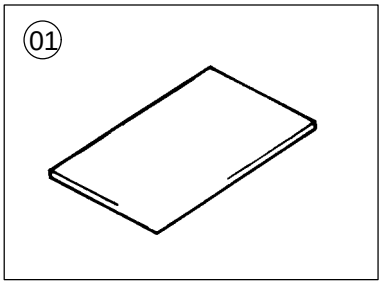

IC70B Version: 10G032-00 ➡ 10G037-00

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →	I	SE/NO.	AREA
01	46-35AB	1155-0753-02	1155-0753-03	46-35AC	JIG MEMORY CARD	1	1 Y	001925	0000