

SERVICE BULLETIN

■ PROBLEM	●	FUNCTION	○	SAFETY
	○	SERVICEABILITY	○	OTHERS
□ OTHERS	○	PERFORMANCE	○	CORRECTION
	○	SAFETY REGULATION	○	OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 023
DATE : 990114
SUBJECT : SOFTWARE PROGRAM FOR IC2A ON PWB-A CHANGE

The software program for IC2A (01, 02) on PWB-A has been changed to correct the following problems.
1. ”C0510” is falsely displayed when the Front Door is opened and closed immediately after the Energy Saver mode has been canceled.
2. Despite a change made in the setting for “Print Exposure” of User’s Choice or “Image Density” of Adjust, the image density setting of the first copy made after that remains unchanged.
3. C-1330 occurs when the Stop Key is pressed during a copy cycle.

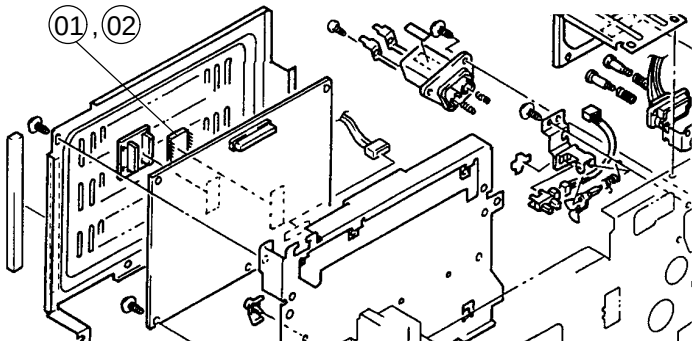

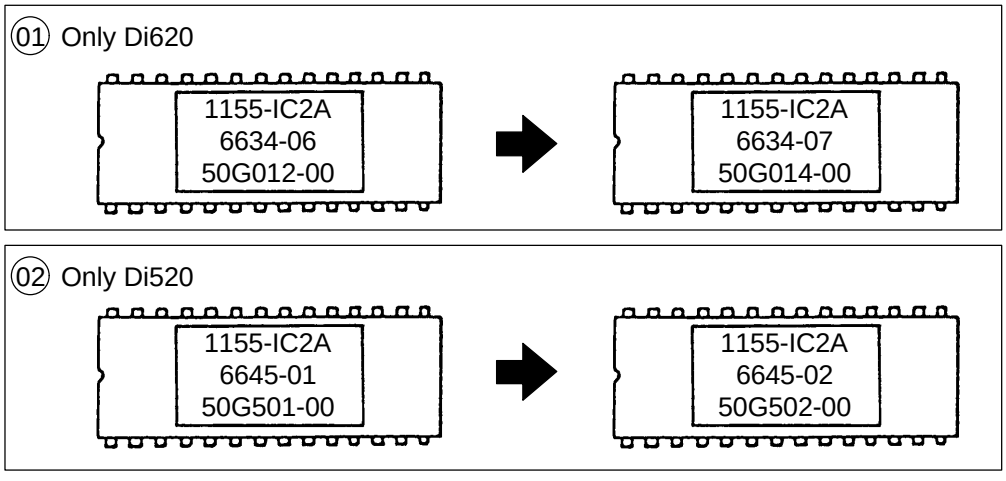

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →		I	SE/NO.	AREA
01	36-31AB	1155-6634-06	1155-6634-07	36-31AC	IC	1	1	Y	003141	0000
02	36-31BA	1155-6645-01	1155-6645-02	36-31BB	IC	1	1	Y	003501	0000