

SERVICE BULLETIN

■ PROBLEM	●	FUNCTION	○	SAFETY
	○	SERVICEABILITY	○	OTHERS
□ OTHERS	○	PERFORMANCE	○	CORRECTION
	○	SAFETY REGULATION	○	OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 035
DATE : 990602
SUBJECT : CHANGE OF CABLE MOUNTING BRACKET

PROBLEM: The Cable Mounting Bracket (02) installed on the Scanner Assy (01) can at times be broken.
CAUSE: When the Scanner is moved, the Scanner Drive Cable interferes with the Cable Mounting Bracket (02), causing the Cable Mounting Bracket (02) to wear.
SOLUTION: The following changes have been made to increase the strength of the Cable Mounting Bracket (02).
-The shape of the Cable Mounting Bracket (02) has been changed.
-A Screw hole has been made in the Scanner Assy (01).
-As a result of the change made in the shape of the Cable Mounting Bracket (02), a tapping screw (9735-0306-13) has been added.

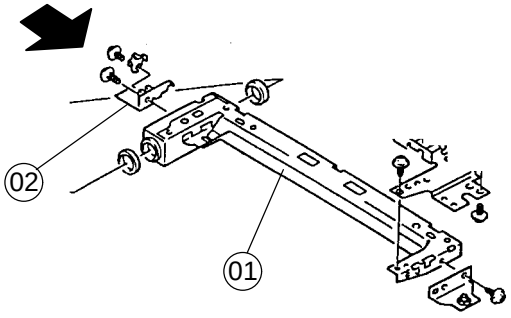

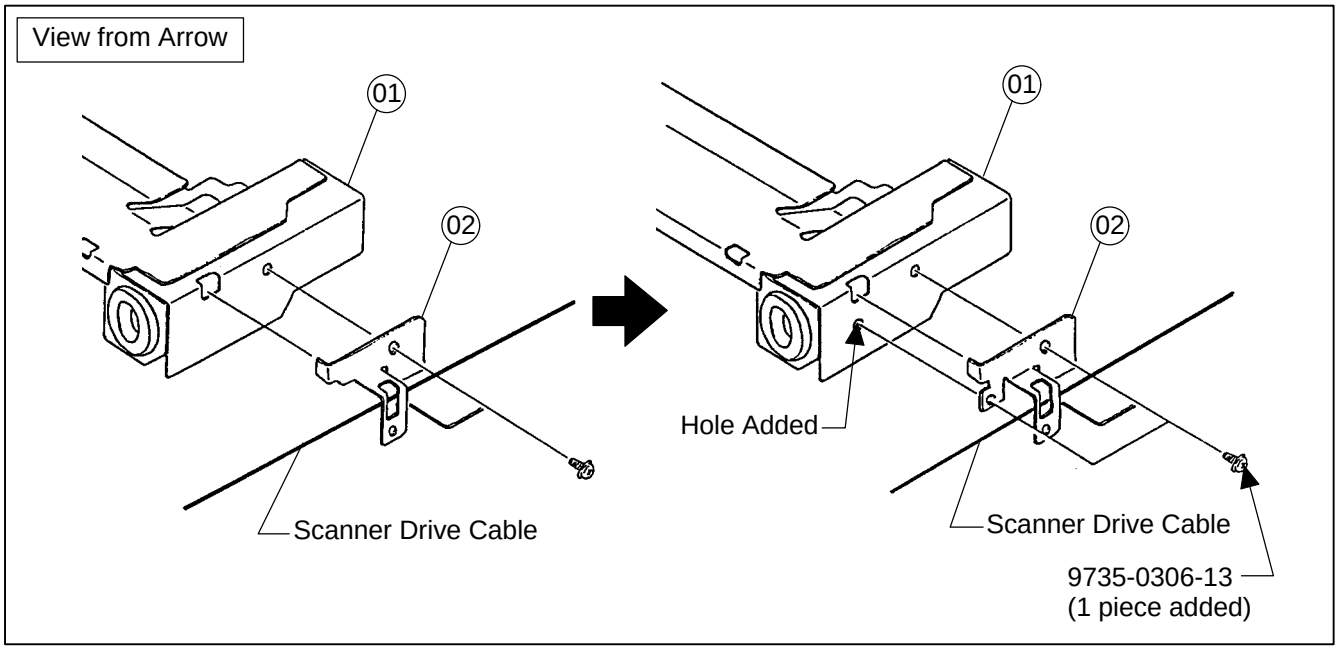

NOTE: The new Bracket (02) must be installed in premodification machines with the new 1st Slider (01).

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →		I	SE/NO.	AREA
01	12-17AA	1155-0152-01	1155-0152-02	12-17AB	1ST SLIDER	1	1	Y	009409	0000
02	12-10AA	1155-1411-02	1155-1411-03	12-10AB	BRACKET	1	1	S	009409	0000