SERVICE BULLETIN


■ PROBLEM	○ FUNCTION	○ SAFETY
	○ SERVICEABILITY	● OTHERS
□ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	○ OTHERS


MODEL NAME : Di620
MODEL CODE : 1155
NO. : 038
DATE : 990714
SUBJECT : C0110 DISPLAY


PROBLEM: There is a possibility that malfunction "C0110" may at times occur due to the malfunctioning corona wire cleaning mechanism of the image transfer/paper separator coronas unit (01).

CAUSE: The corona wire cleaner moves back and forth on the corona wire, controlled as detailed below. If, however, there are variations in the accuracy of parts of the image transfer/paper separator coronas unit (01), the cleaner reaches the very end of the screw of the transport shaft (02) and goes beyond the screw part before 11.6 sec. elapse after the cleaning motor (M8) has started turning forward.

SOLUTION: The screw part of the transport shaft (02) has been made longer to give allowance for the cleaner motion.

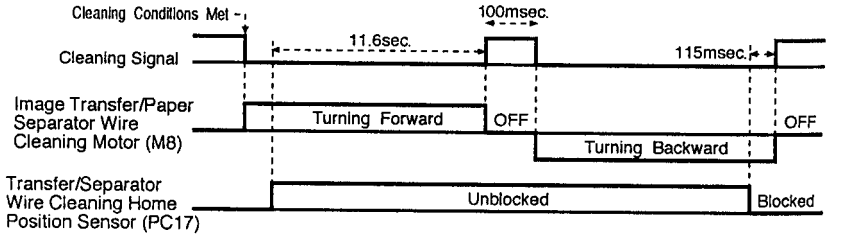

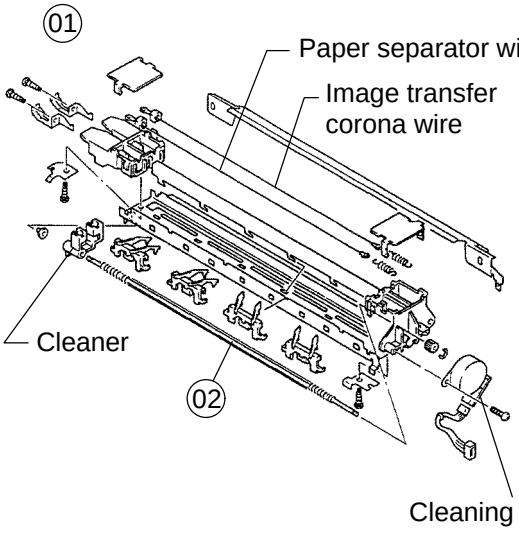

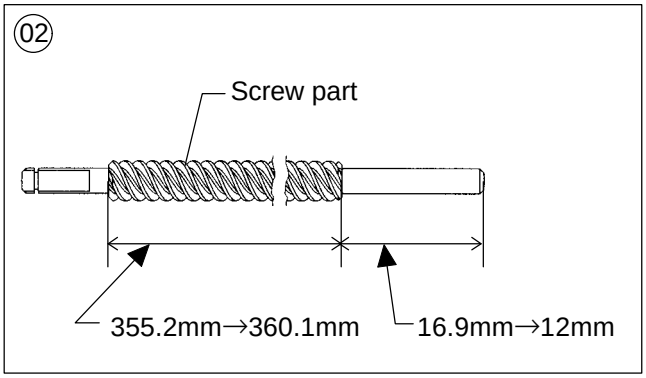

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →	QTY I	SE/NO.	AREA
01	24-35AA	1155-0357-01	1155-0357-03	24-35AB	TRANS/SEP CORONA	1	1 Y	255736	0000
02	24-26AA	1075-4161-02	1075-4161-03	24-26AB	CONVEYOR SHAFT	1	1 Y	255736	0000