SERVICE BULLETIN

☐ PROBLEM	○ FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
■ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	● OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 040L
DATE : 990830
SUBJECT : SOFTWARE PROGRAM OF IC26IB ON PWB-IB CHANGE

The software program of IC26IB (01, 02) on P. W. Board-IB has been changed to make the following specification change.


When documents are loaded over capacity (100 sheets) on the document feed tray:

Before Modification

C143E (Problem with EDH Pick-Up Motor) is detected.

After Modification

EDH Misfeed at Take-Up section is detected.

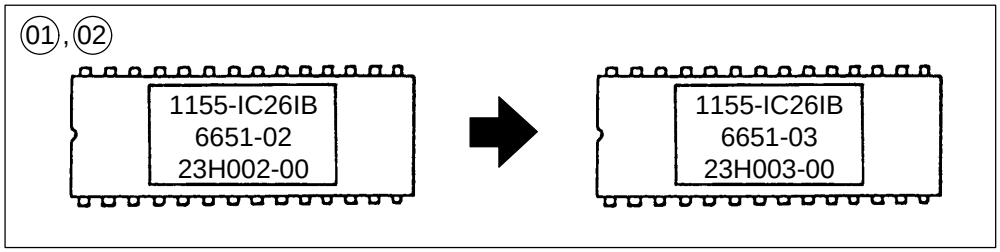

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →		I	SE/NO.	AREA
01	11-32CB	1155-6651-02	1155-6651-03	11-32CC	IC	1	1	Y	013932	2705
02	11-32EA	1155-6651-02	1155-6651-03	11-32EB	IC	1	1	Y	013932	2704