REPLACEMENT PROCEDURES OF MODIFID PART
(Shaft : 2mm extended) for the noise from Duplex Unit

99/11/11

1.Remove the Rear Cover (1155-1003-02).
2. Open the Front Lower Door (1155-1051-02) and slide out the Duplex Unit.
3. Pull out the used Toner Bottle.
4.Replace the Shaft(2mm extended).


1155-5770-02 ->1155-5770-?(itís not set yet.)

<Removing Procedures>


1) Remove the E-ring îAî and the Bearing.
2) Remove the E-ring ìBî securing the Gear.
3) Pull out the Shaft.

<Mounting Procedures>

Opposite order of ìRemoving Proceduresî

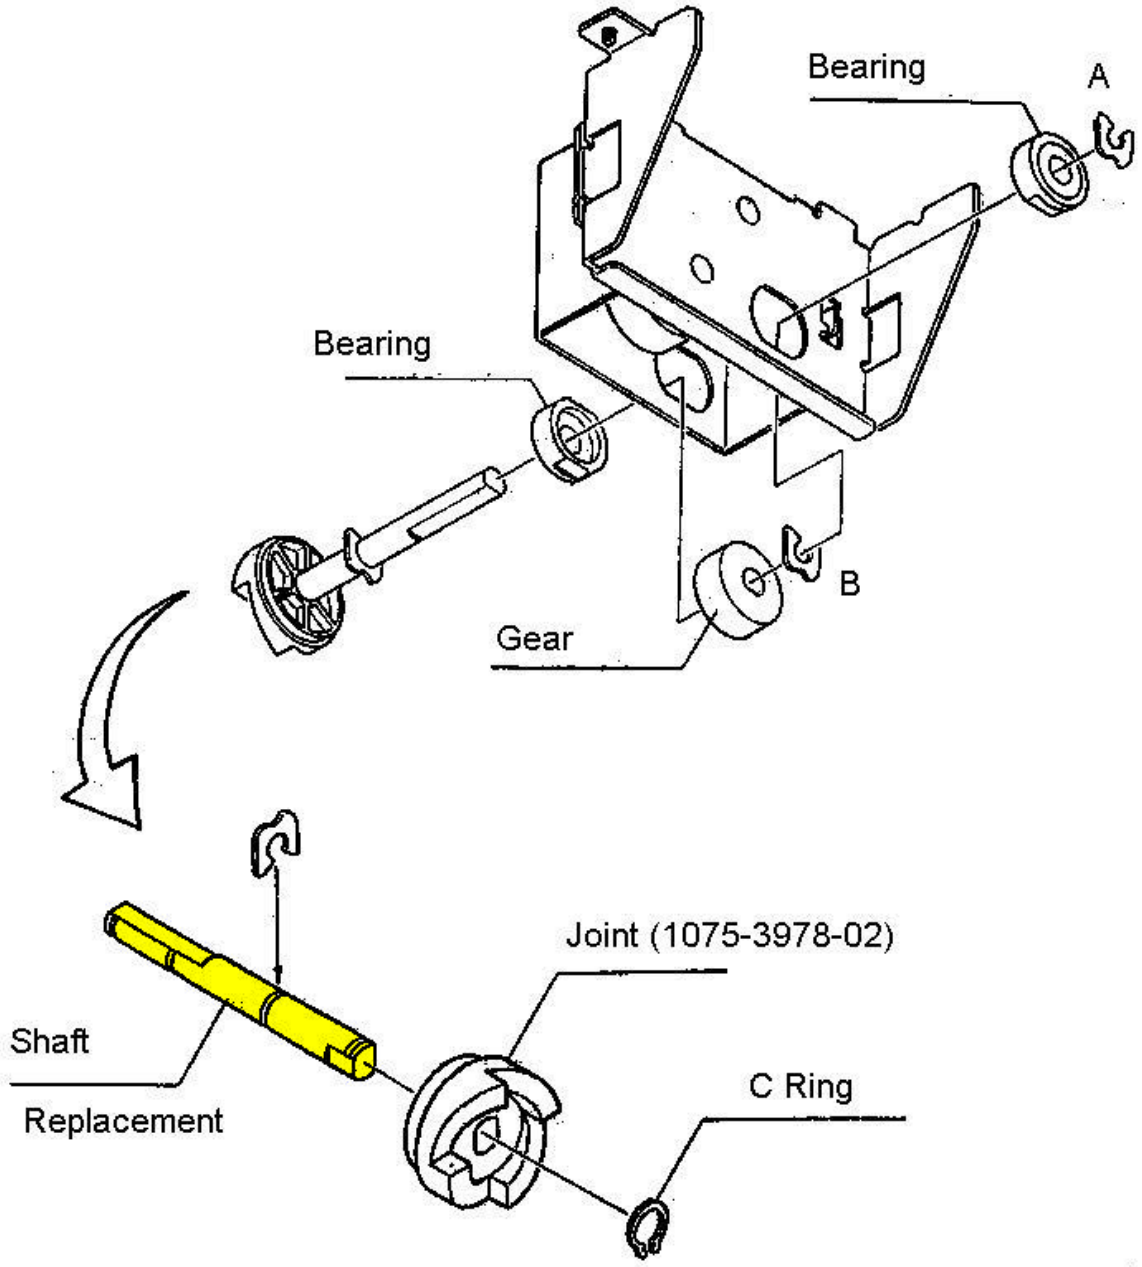

5.Put back the Duplex Unit, and close the Front Lower Door.
6.Make sure that paper is fed correctl y.
7.If noise is still produced, adjust the position of the Bracket.
Loosen thescrews(a,b),and turn Bracket until it doesn't move,and secure it where no noise is produced.

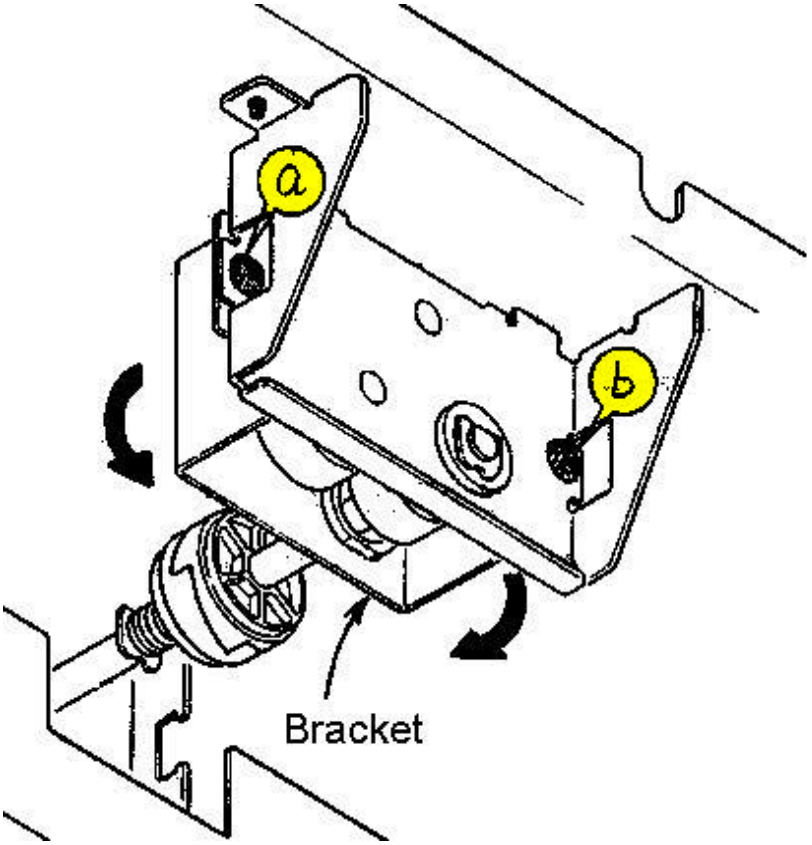

8. Mount the RearCover .