Symptom	Step	Check Item	Result	Action
• Paper is stationary before the Vertical Transport Rollers.		Check 4th Drawer Paper Take-Up Sensor PC29 as follows. (See p. T-7.)		
	2	1) Select the function "Paper Path Sensor" and check to see if the data for sensor code 4 is set to "1." 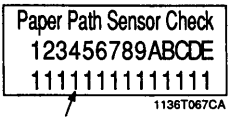 1136T067CA 2) Move the actuator with a sheet of paper to block PC29.	NO	• Check the actuator for operation. • Check PC29.
		3) Has the data for 4 changed from "1" to "0"? 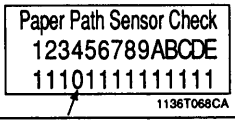 1136T068CA	NO	Replace PC29.
			YES	Replace PWB-A or PF-202 PWB-A. First replace PF-202 PWB-A, then replace EP2050 PWB-A if necessary.
	3	Is Vertical Transport Drive Motor M21 turning when the Start Key is pressed?	NO	First replace PF-202 PWB-A, then replace EP2050 PWB-A if necessary. Check M21.
			YES	Check for possible overload.
	4	Is the Vertical Transport Roller or Guide Plate deformed, worn, or dirty with paper dust?	YES	Clean or replace the Vertical Transport Roller or Guide Plate.