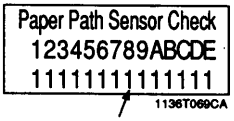
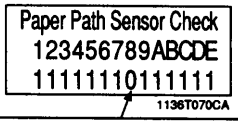
Symptom	Step	Check Item	Result	Action
	2	Is Vertical Transport Drive Motor M21 turning when the Start Key is pressed?	NO	First replace PF-102 PWB-A, then replace EP2050 PWB-A if necessary. Check M21.
			YES	Check for possible overload.
	3	Is the Vertical Transport Roller or Guide Plate deformed, worn, or dirty with paper dust?	YES	Clean or replace the Vertical Transport Roller or Guide Plate.
• Paper is stationary near Vertical Transport Detection Sensor 4 PC22.	1	Check PC22 as follows. (See p. T-7.)		
		1) Select the function "Paper Path Sensor" and check to see if the data for sensor code 8 is set to "1."  1136T069CA 2) Move the actuator with a sheet of paper to block PC22.	NO	• Check the actuator for operation. • Check PC22.
		3) Has the data for 8 changed from "1" to "0"?  1136T070CA	NO	Replace PC22.
			YES	First replace PF-102 PWB-A, then replace EP2050 PWB-A if necessary.
	2	Is the Vertical Transport Roller or Guide Plate deformed, worn, or dirty with paper dust?	NO	Check the Paper Feed Cabinet for positive connection to the copier.
			YES	Clean or replace the Vertical Transport Roller or Guide Plate.