Symptom	Step	Check Item	Result	Action
• Paper is stationary near the Vertical Transport Section.	4	Check Vertical Transport Sensor 3 PC17 as follows. (See p. T-7.)		
		1) Select the function "Paper Path Sensor" and check to see if the data for sensor code 7 is set to "1."  1136T096CA 2) Move the actuator with a sheet of paper to block PC17.	NO	• Check the actuator for operation. • Check PC17.
		3) Has the data for 7 changed from "1" to "0"? 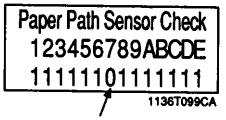 1136T099CA	NO	Replace PC17.
			YES	First replace PF-202/PF-102/PF-2D PWB-A, then replace EP2050 PWB-A if necessary.