*C0d00

Step	Check Item	Result	Action
1	Does M33 turn when the Power Switch is turned ON or Duplex Unit slid into position?	NO	Replace M33, PWB-G, PF-202/PF-102/PF-2D PWB-A, or EP2050 PWB-A, in that order.
		YES	Check for possible overload.
2	Check PC9 as follows. (See p. T-5, 6.) 1) Block PC9. (The Front/Rear Edge Guide Plates are at their home positions.) 2) Port: P43-5 3) Select the function "Port."		
	4) Is the data for P43-5 set to "L"? 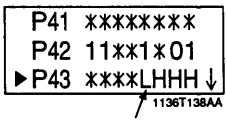	NO	Replace PC9.
		YES	Replace PWB-G, PF-202/PF-102/PF-2D PWB-A, or EP2050 PWB-A, in that order.