RN SERIES TECHNICAL BULLETIN

Data Category	☐ Field Modification	■ Trouble-Shooting	☐ General Information	☐ Safety Advice

DISTRIBUTED TO : All Distributors

DATE : 22 March, 2001

MODEL : All "RN" models

ISSUE NO. : RNT-004

Our Ref.: AC1-1856
AC1-1857

Proceeding Grade
- ☐ Action ASAP
- ☐ Action as given below
- ■ Action if required
- ☐ Refer in need

Parts Compatibility
- ☐ Compatible
- ☐ Conditionally Compatible
- ☐ Not Compatible
- ■ Old Obsolete

Handling of Modified Parts
- ☐ Free of Charge
- ☐ Conditionally Chargeable
- ■ Chargeable

SUBJECT: 021-19099-105 Guard Cover; Compression Plate
021-19094-103 Holder; Compression Plate

Brief:

Above two parts are redesigned so that the Guard Cover is held by screws, instead of by adhesive tapes, to prevent it from coming loose.

Reason:

After continuous master compressing operation, the adhesive tape on the Guard Cover becomes weak, causing the Guard Cover to come loose. The loose Guard Cover causes master removal jam.

Newly-registered Part

021-19099-105 Guard Cover; Compression Plate
021-19094-103 Holder; Compression Plate

Note:
Since the two additional holes on the new Holder is not tapped, you will need to use two pieces of "RS Tight" 3x6 tapping screws.
This screw will be supplied by Riso Kagaku.

021-19099-008
Guard Cover; Compression Plate



021-19099-105
Guard Cover; Compression Plate

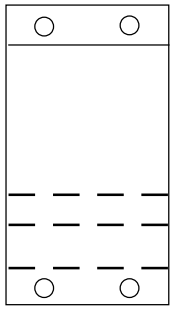

021-19094-006
Holder; Compression Plate

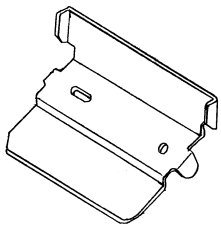

021-19094-103
Holder; Compression Plate

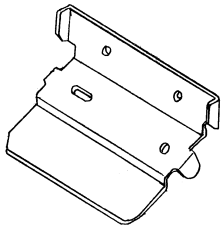

Please refrain from ordering this part yet, as the part has not come into our stock yet. We will inform you when ready.

Application Serial No.

RN2130UI 85131299	RN2100EP 85150835	RN2050AW 85250385
RN2030UI 85221754	RN2000EP 85200691	RN2130AS 85140145
RN2000UI 85431030	RN2150EP 85080283	RN2030AS 85210255
RN2150UP 85070016	RN2050EP 85270240	RN2180C 85420076
RN2050UP 85280051	RN2150AN 85110038	RN2080C 85410180
RN2150EN 85090001	RN2050AN 85240217	
RN2050EN 85260001	RN2150AW 85100235	

Attached :