RN SERIES TECHNICAL BULLETIN

Data Category	☐ Field Modification	■ Trouble-Shooting	☐ General Information	☐ Safety Advice

DISTRIBUTED TO : All Distributors

DATE : 5 March, 2001

MODEL : All "RN" models

ISSUE NO. : RNT-007

Our Ref.: C1-1433

Proceeding Grade
- ☐ Action ASAP
- ☐ Action as given below
- ■ Action if required
- ☐ Refer in need

Parts Compatibility
- ☐ Compatible
- ☐ Conditionally Compatible
- ☐ Not Compatible
- ■ Old Obsolete

Handling of Modified Parts
- ☐ Free of Charge
- ☐ Conditionally Chargeable
- ■ Chargeable

SUBJECT: 021-18201-208 Master Loading Sheet

Brief:
The adhesive tape width was narrowed down from 7mm to 6.5mm.

Reason:
The extended portion of the Mylar sheet in some occasions did not rise high enough, when lifted by the opened Clamp Plate, causing the sponges to block the way of the master material coming towards the drum.

Modification:
The 0.5mm margin on the Mylar sheet allows the 5 extended out pieces of the Mylar sheet with the sponges to rise at more acute angle when lifted by the opened Clamp Plate.
This allows the sponges to lift higher, and clears the way for the master material during the master loading on the drum.

Newly-registered Part
021-18201-208 Master Loading Sheet

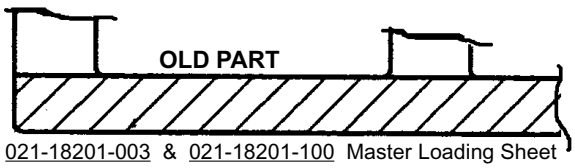

021-18201-003 & 021-18201-100 Master Loading Sheet

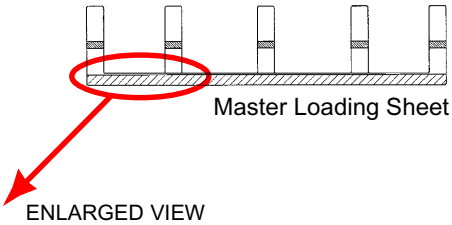

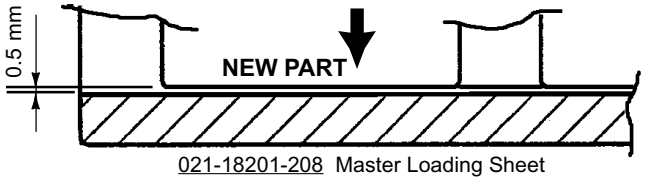

021-18201-208 Master Loading Sheet

Please refrain from ordering this part yet, as the part has not come into our stock yet. We will inform you when ready.

Application Serial No.

RN2130UI 85131220	RN2100EP 85150655	RN2050AW 85250360
RN2030UI 85221754	RN2000EP 85200485	RN2130AS 85140145
RN2000UI 85430585	RN2150EP 85080198	RN2030AS 85210255
RN2150UP 85070016	RN2050EP 85270175	RN2180C 85420055
RN2050UP 85280051	RN2150AN 85110021	RN2080C 85410165
RN2150EN 85090001	RN2050AN 85240193	
RN2050EN 85260001	RN2150AW 85100190	

Attached :