RN SERIES TECHNICAL BULLETIN

Data Category	☐ Field Modification	■ Trouble-Shooting	☐ General Information	☐ Safety Advice

DISTRIBUTED TO : All Distributors

DATE : 13 April, 2001

MODEL : All "RN" models

ISSUE NO. : RNT-015

Our Ref.: C1-1851
C1-1852

Proceeding Grade
- ☐ Action ASAP
- ☐ Action as given below
- ■ Action if required
- ☐ Refer in need

Parts Compatibility
- ☐ Compatible
- ☐ Conditionally Compatible
- ☐ Not Compatible
- ■ Old Obsolete

Handling of Modified Parts
- ☐ Free of Charge
- ☐ Conditionally Chargeable
- ■ Chargeable

SUBJECT: 021-16027-006 Bracket B; Junction Gear


Brief:
The shape of the bracket is changed to give more strength.

Reason:
In some cases, the old type Bracket deformed during printing operation and resulted in breakage of the Junction Gear on the Drum.

Modification:
The modification on the part was made as per illustration below.

Newly-registered Part
021-16027-006 Bracket B; Junction Gear

This portion of the Bracket was weak in design . The new design gives more strength.

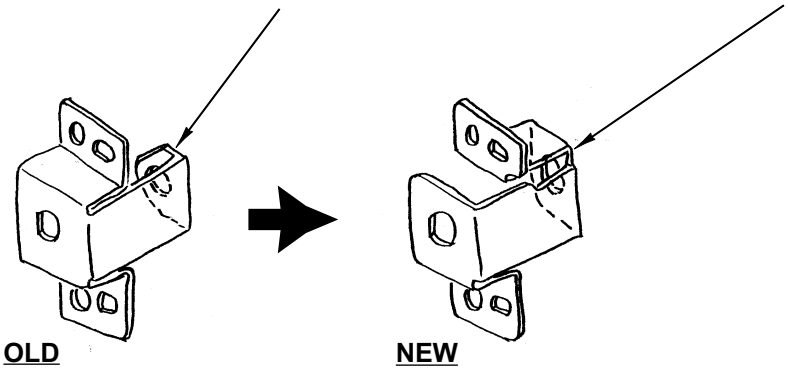

OLD
021-16025-208
Bracket; Junction Gear

NEW
021-16027-006
Bracket B; Junction Gear

Application Serial No.

RN2130UI 85130000
RN2030UI ..... 8522000[illegible]
RN2000UI ..... 85[illegible]
RN2150UP ..... [illegible]
RN205[illegible] ..... [illegible]280000
RN21[illegible] 85090000
RN205[illegible]EN 85260000

'2100EP 85150000
[illegible]N2000EP 85200000
RN2150EP 85080000
RN2050EP ..... 8527000[illegible]
RN2150AN ..... 85[illegible]
RN2050AN ..... 85[illegible]00
RN2150AW 85100000

RN205[illegible] 85250000
[illegible] 85140000
[illegible]0AS 85210000
[illegible]N2180C 85420000
RN2080C 85410000

To be informed later

To be informed later