RN SERIES TECHNICAL BULLETIN

Data Category	☐ Field Modification	■ Trouble-Shooting	☐ General Information	☐ Safety Advice

DISTRIBUTED TO : All Distributors

DATE : 25 April, 2001

MODEL : All "RN" models

ISSUE NO. : RNT-018

Our Ref.: AC1-1883
AC1-1884

Proceeding Grade
- ☐ Action ASAP
- ☐ Action as given below
- ■ Action if required
- ☐ Refer in need

Parts Compatibility
- ☐ Compatible
- ■ Conditionally Compatible
- ☐ Not Compatible
- ☐ Old Obsolete

Handling of Modified Parts
- ☐ Free of Charge
- ☐ Conditionally Chargeable
- ■ Chargeable

SUBJECT: 021-11211-208 Front Cover
021-11276-008 Front Cover SW Actuator


Brief:
The projected portion on the inside surface of the Front Cover, which acts as an actuator for the front cover switch, is now detachable from the Front Cover.

Reason:
If the projected portion acting as switch actuator cracks off, the whole Front Cover had to be replaced.

Modification:
The Front Cover is redesigned so that when the switch actuator breaks, the whole Front Cover need not be replaced, but only the actuator portion needs to be replaced. The newly registered Front Cover SW Actuator does not fit onto the old type Front Cover.

NOTE:
Of the three holes on the Front Cover SW Actuator, the center hole is for the positioning pin on the Front Cover, and the two holes on the sides are for screws.
Two (2) pieces of M3x10 tapping screws are required.

Newly-registered Part
021-11211-208 Front Cover
021-11276-008 Front Cover SW Actuator

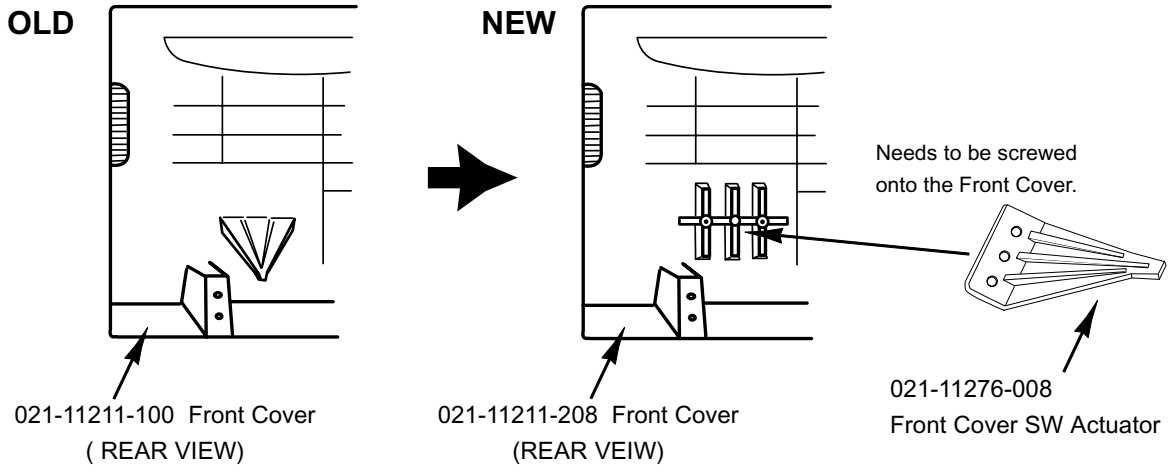

Application Serial No.

RN2130UI 85130000	'2100EP 85150000	RN20 85250000
RN2030UI 8522000	N2000EP 85200000	 85140000
RN2000UI 85	RN2150EP 85080000	UAS 85210000
RN2150UP 0	RN2050EP 8527000	RN2180C 85420000
RN205 280000	RN2150AN 85	RN2080C 85410000
RN21 85090000	RN2050AN 85 00	
RN205UEN 85260000	RN2150AW 85100000	

To be informed later

To be informed later