
(7) C0500: Warming-Up Failure
C0510: Abnormally Low Fusing Temperature
C0520: Abnormally High Fusing Temperature

Relevant Electrical Parts	
Heater Lamp H1 Fusing Thermoswitch TS1 Thermistor TH1	DC Power Supply 2 PU2 Master Board PWB-A

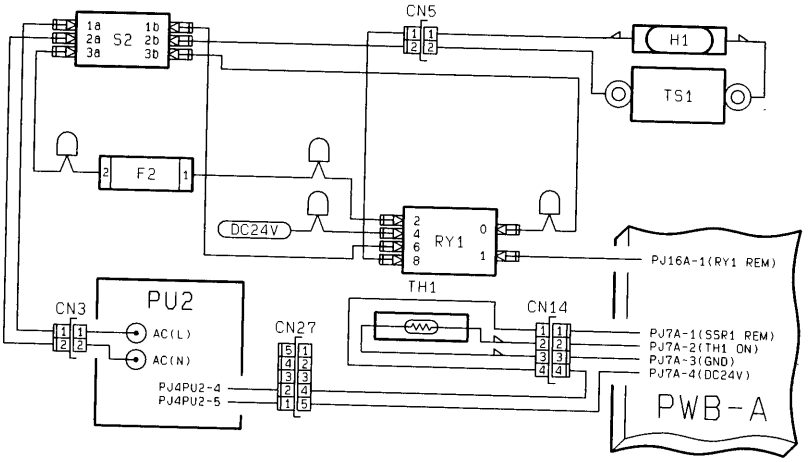

1177C20TAB