
SERVICE BULLETIN


☐ PROBLEM	○ FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
■ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	● OTHERS


MODEL NAME : Di620
MODEL CODE : 1155
NO. : 005
DATE : 980702
SUBJECT : HARNESS CHANGE

To increase production efficiency, the following modifications have been implemented.

1. For harness 01, the position of the tie band has been changed.
2. For harness 01 and 02, CN59 was changed from a CT connector to an SMP connector.

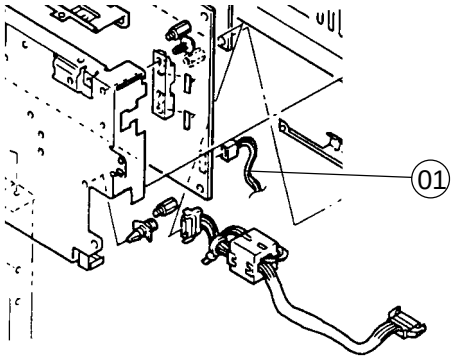

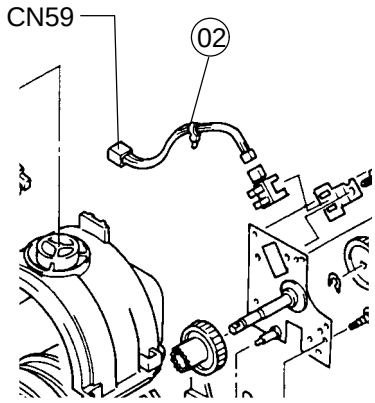

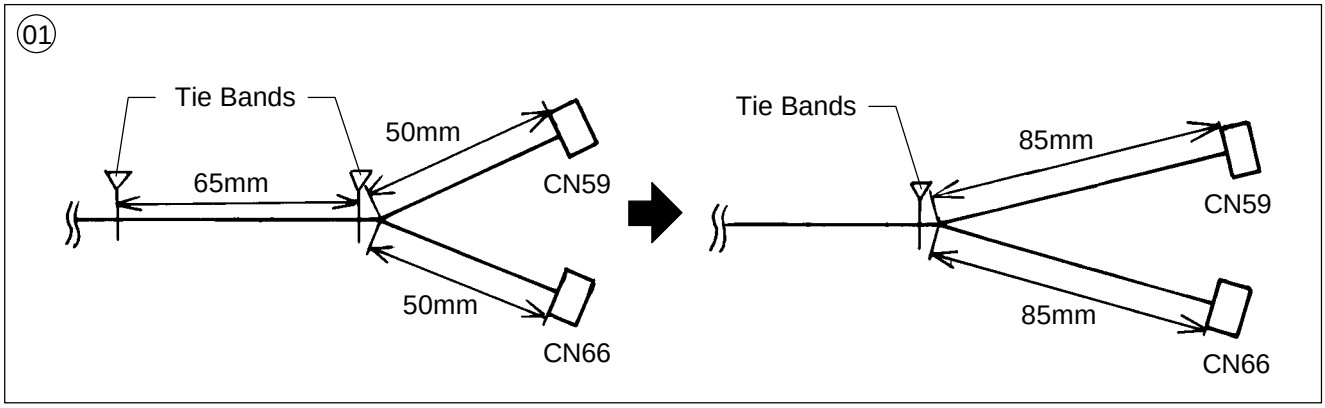

NOTE: The new harnesses (01, 02) must be installed in premodification machines together as a set.

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →	QTY I	SE/NO.	AREA
01	36-59AA	1155-6842-03	1155-6842-14	36-59AB	HARNESS	1	1 S	000571	0000
02	16-46AA	1075-6871-03	1155-6861-01	16-46AB	HARNESS	1	1 S	000571	0000