
SERVICE BULLETIN

☐ PROBLEM	○ FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
■ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	● OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 007
DATE : 980709
SUBJECT : MANUAL FEED SECTION CHANGE

A potentiometer mechanism is not necessary for this machine, therefore, it has been removed. Due to this, the paper guides may be opened too far. To prevent this, a rubber cushion (01) has been added to the position shown below.

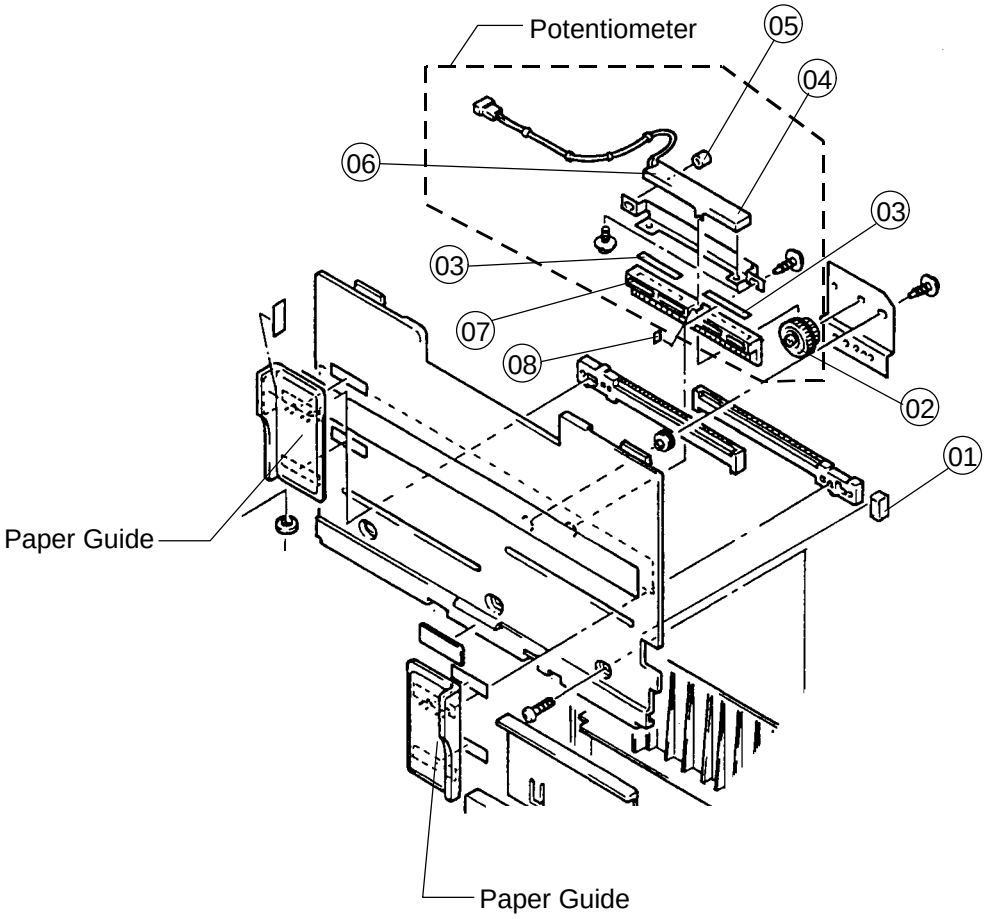

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →	I	SE/NO.	AREA
01			1155-3306-01	13-47AA	RUBBER CUSHION	1	Y	000800	0000
02	13-39AA	1075-3361-01			GEAR 19/25T	1	–	000800	0000
03	13-41AA	1075-3387-01			POLYESTER FILM	2	–	000800	0000
04	13-42AA	1075-0130-02			RESISTOR	1	–	000800	0000
05	13-43AA	1200-2105-05			COLLAR	1	–	000800	0000
06	13-44AA	1075-3325-01			BRACKET	1	–	000800	0000
07	13-45AA	1075-3360-01			RACK GEAR	1	–	000800	0000
08	13-46AA	1075-3388-01			POLYESTER FILM	1	–	000800	0000