
SERVICE BULLETIN

☐ PROBLEM	○ FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
■ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	● OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 030
DATE : 990408
SUBJECT : NEW PM PART

The guide film in the turnover section has been designated as a PM part. The replacement cycle is shown bellow. To make replacement in the field easier, the guide (01) has been changed to the guide plate assy (01) with the guide film affixed.

Model	Replacement Cycle
Di620	1200K
Di520	1280K

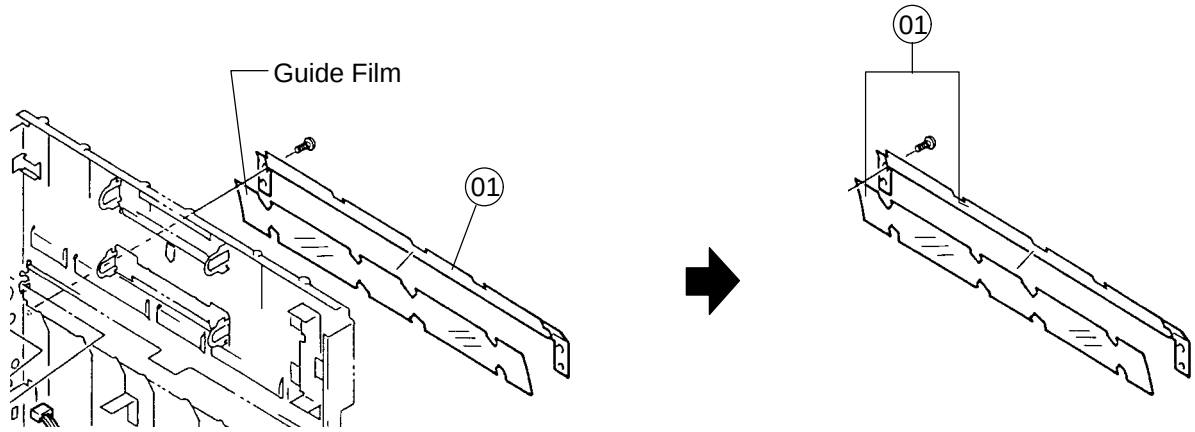

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →	I	SE/NO.	AREA
01	33-39AA	1155-3821-01	1155-0755-01	33-39AB	GUIDE PLATE ASSY	1 1	Y	- - - - - -	0000