SERVICE BULLETIN


☐ PROBLEM	○ FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
■ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	● OTHERS


MODEL NAME : Di620
MODEL CODE : 1155
NO. : 032
DATE : 990428
SUBJECT : COVER CHANGE

In order to make it possible to install the Finishers FN-102 and FN-502, the following changes have been implemented :

1. Two rectangular holes for the installation of the Finisher have been added to the Left Cover-Fnt (01) and Left Cover-Rr (02).
2. Due to the addition of the rectangular holes in the Left Cover-Fnt (01) and Left Cover-Rr (02), the new Covers (03) are removable.

In addition, because of differences in the way parts are installed, there is a possibility that the Left Cover-Rr (02) and Left Cover-Upr may interfere with each other. To prevent this, the shape of the Plate (04) has been changed to prevent interference.

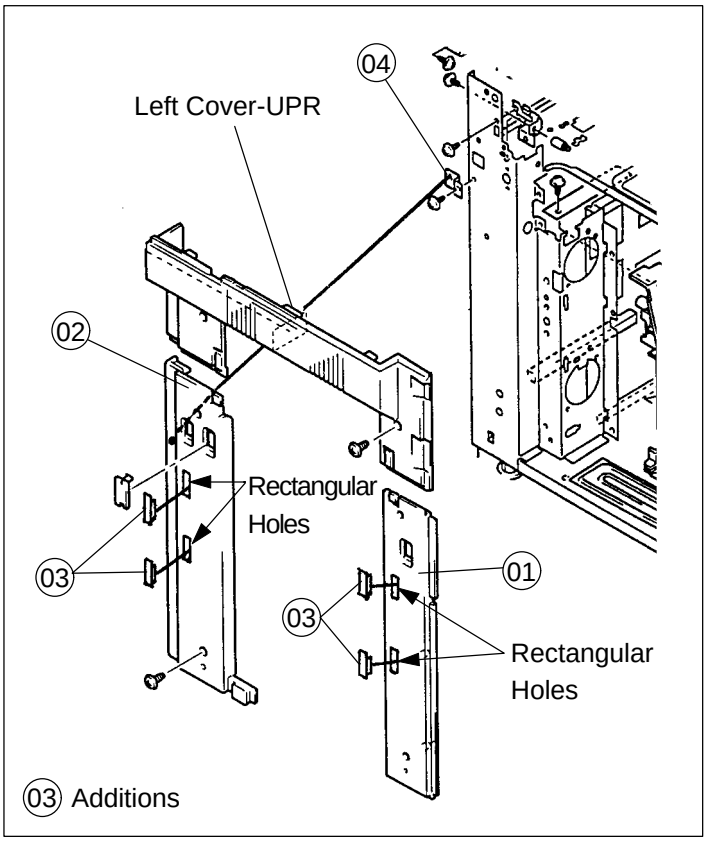

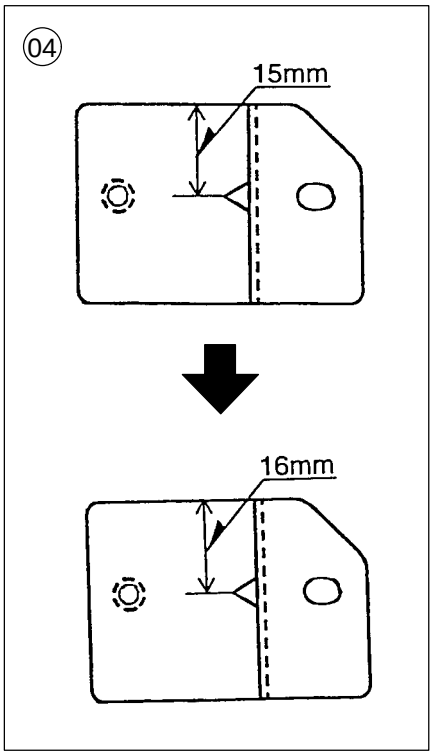

NOTE: The new Covers (03) must be installed with the new Left Cover-Fnt (01) and Left Cover-Rr (02) as a set in premodification machines.

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →		I	SE/NO.	AREA
01	02-12AA	1155-1068-01	1155-1068-02	02-12AB	LEFT COVER-FNT	1	1	Y	003821	0000
02	02-10AA	1155-1069-02	1155-1069-03	02-10AB	LEFT COVER-RR	1	1	Y	003821	0000
03			1139-1039-01	02-31AA	COVER		4	S	003821	0000
04	06-30AA	1075-1009-01	1075-1009-02	06-30AB	PLATE	1	1	Y	002902	0000