(6) Adjustment of Crosswise Magnification

◆**Requirement**

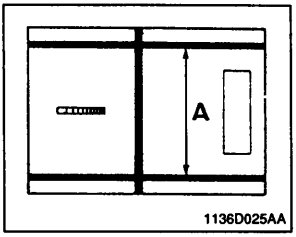

- A copy of dimension A on the GTC-001 chart should measure the value shown in the table below when copied under the conditions given in the table.
- Setting range: 43-58

Magnification	Tolerance	Adjustment mode
Full size (×1.000)	200 ±1.0 mm	A-1
Enlargement (×2.000)	200 ±1.5 mm	
Reduction (×0.500)	100 ±1.5 mm	

◆**Important**

- This adjustment should be made before the adjustments for Reference Position, Adjustments (8) and (9).

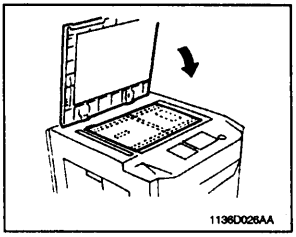

1. Place the GTC-001 chart face down on the Original Glass and align its rear left corner with the reference position marker on the Original Width Scale on the left side of the platen. Close the Original Cover.
2. Make five full size copies on A3 paper. Compare the dimension of reference line A on the 5th copy with that on the test chart. If the dimension is outside the tolerance, adjust the magnification setting in the following procedure.

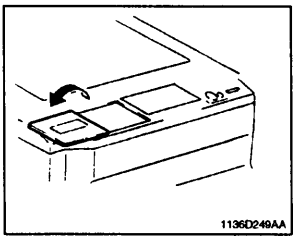

3. Open the System Panel.