
(5) When the copier has found that the AIDC Sensor is faulty, the intensity of LA1 light is increased by 1V each time the time over which the copier has run exceeds 700 minutes. The intensity of LA1 light is also varied in proportion to the changes made in grid voltage varied according to the cumulative time over which the PC Drum has turned.

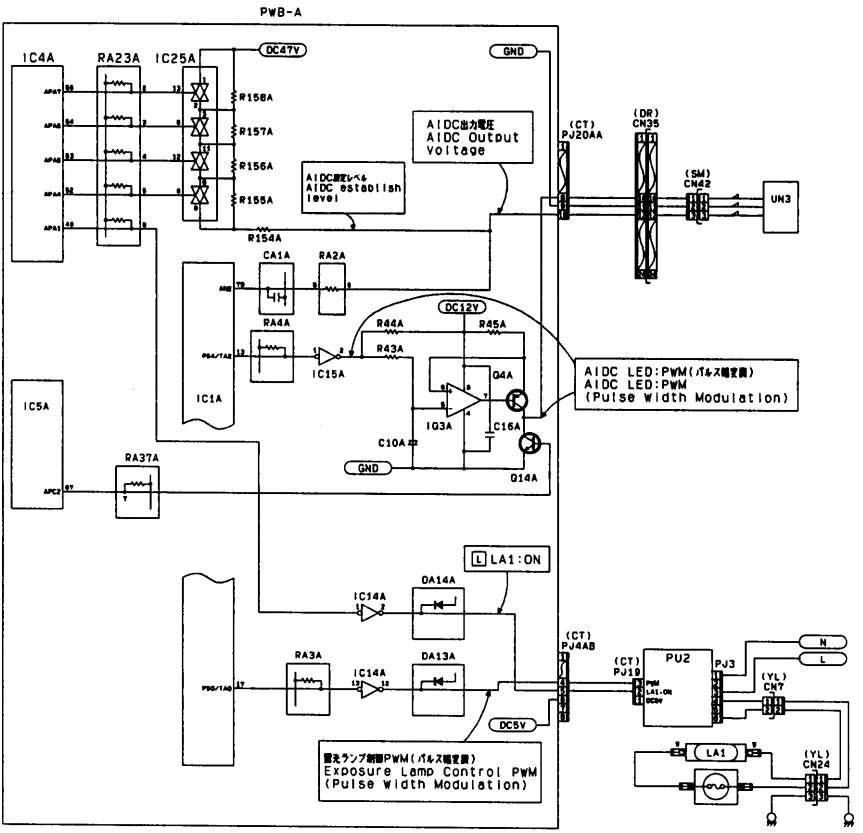

1136C03M