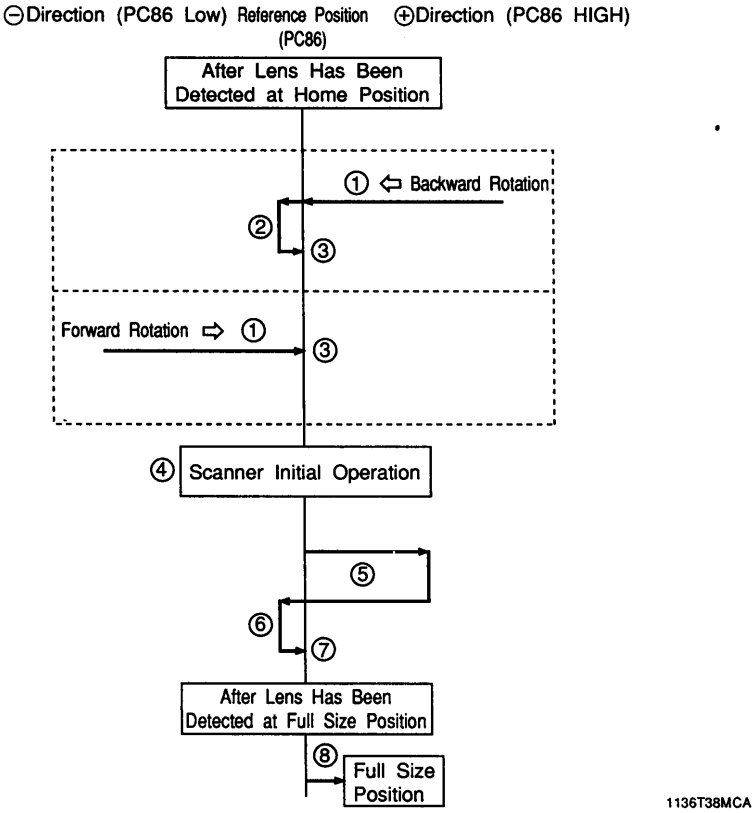


NOTES: • *To enhance positioning accuracy, the 4th/5th Mirrors Carriage is always brought to the full size position from the⊖ side. This compensates for the error produced by backlash in the drive gears.*

• *The operations from ⑤ through ⑦ are performed to check for possible binding of the carriage moving mechanism. (These operations are not performed when the Front Door is closed.)*