

## 2-5. C0400: Exposure Lamp LA1's Failure to Turn ON
## C0410: Exposure Lamp LA1 Turning ON at Abnormal Timing

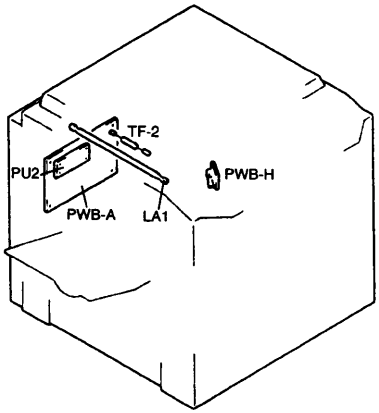


| Symbol | Name |
|---|---|
| LA1 | Exposure Lamp |
| TF2 | Exposure Lamp Thermal Fuse |
| PWB-A | Master Board |
| PWB-H | AE Sensor Board |
| PU2 | Power Supply Unit |

1136T016AA

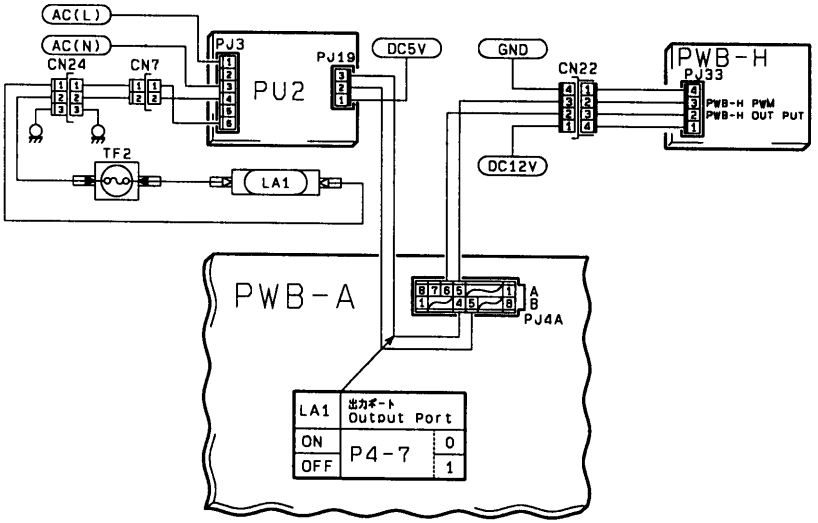


1136C12TAA