

(2) Detection of Toner Collecting Box in Position

- Provided inside the Paper Feed Cabinet (in the copier for EP4000 for the areas other than the U.S.A., Canada, and Europe) is a Toner Collecting Box Set Sensor. If no box is installed, the sensor causes a warning message to appear on the Touch Panel and the initiation of a new copy to be inhibited.

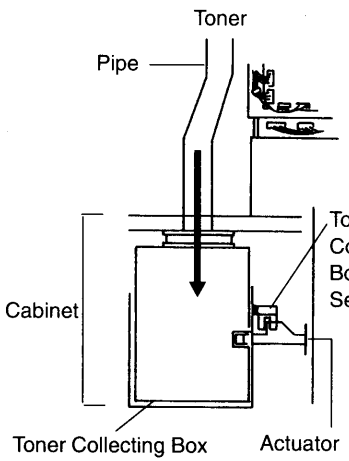

1134M030AA

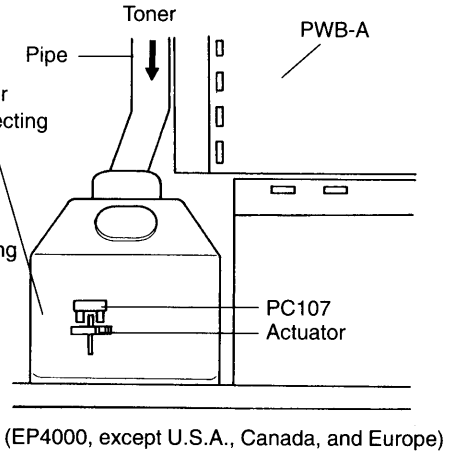

1134M037EA

Controlled Part	Control Signal	Blocked	Unblocked	WIRING DIAGRAM
PC107	PWB-A PJ19A-9	L	H	21-F