3) C0046: Fusing Section Cooling Fan Motor M15's Failure to Turn
C0047: Fusing Section Cooling Fan Motor M15 Turning at Abnormal Timing

Relevant Electrical Parts	
• Fusing Section Cooling Fan Motor M15	• Master Board PWB-A

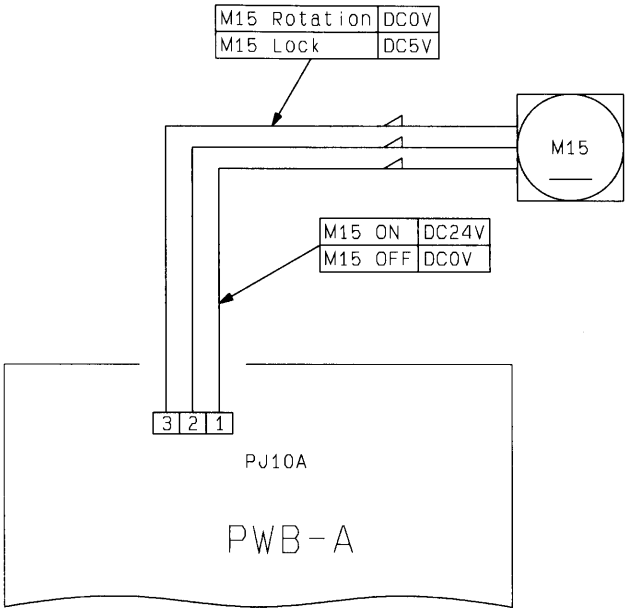

1156C07TAA