
5) C0070: Main Hopper Toner Replenishing Motor M8's Failure to Turn
C0071: Main Hopper Toner Replenishing Motor M8 Turning at Abnormal Timing
C0072: Sub Hopper Toner Replenishing Motor M9's Failure to Turn

Relevant Electrical Parts	
• Main Hopper Toner Replenishing Motor M8 • Sub Hopper Toner Replenishing Motor M9 • Toner Bottle Home Position Sensor PC35	• Master Board PWB-A

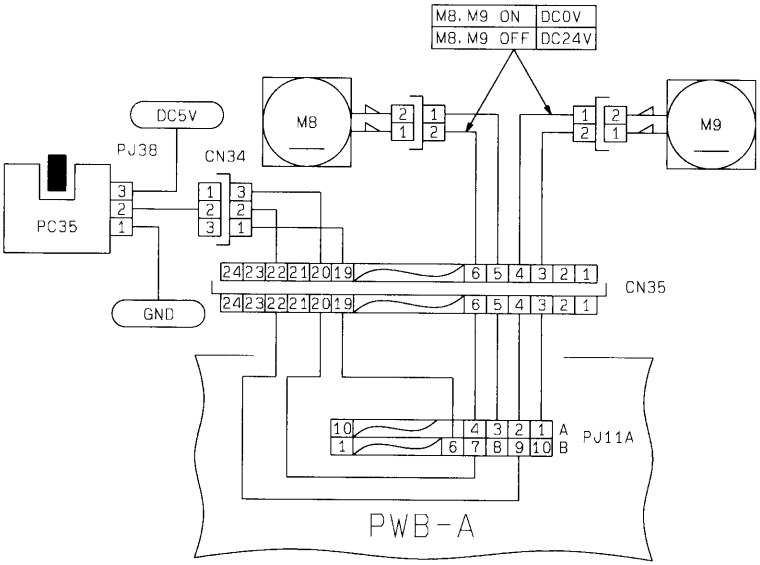

1156C09TAA