Canon

Service Bulletin

COPIER

Issued by Canon Europa N.V.

Model : GP335/405

No.: GP405-002
(FF-T01-J7-000008-01)

DATE: 09.04.99

Location : LENS MOUNT

Subject : NOTES OF CAUTION FOR CCD UNIT INSTALLATION

Reason : Communication of notes of caution for the CCD unit installation

Details : There is a need to exercise caution in removing and installing the CCD unit after shipment from the factory so as to avoid running the risk of a loose fit of the unit to the prescribed position and a failure to maintain the right-angle alignment. Since image verifications, including right-angle alignment, are made at the time of shipping the product from the factory, the only possibility for occurrence of this problem is when the CCD unit is installed or removed during servicing in the field.

Servicing : <Installation Procedure>
1) Tighten the screw ① and check that the fit of the CCD unit is not loose.
2) After checking that, complete the installation procedure by tightening the screw ②.

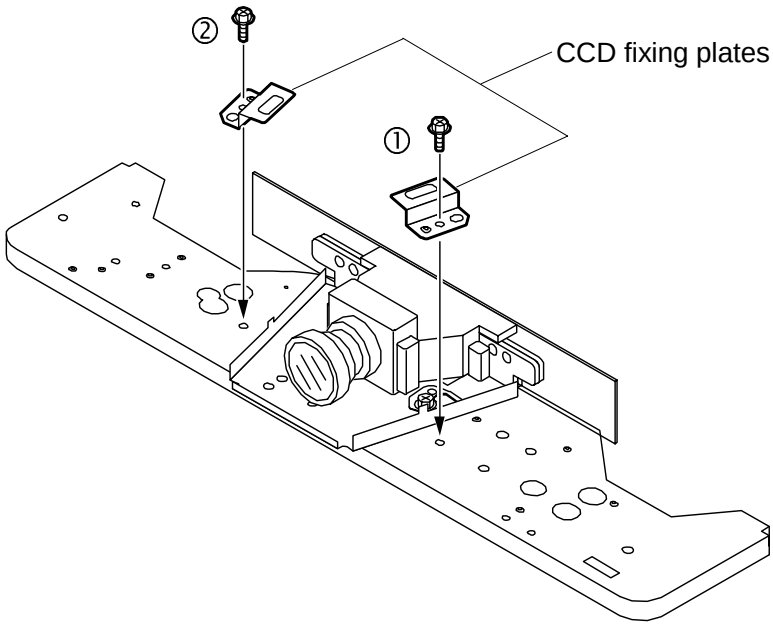


Fig. CCD lens mount