Issued by Canon Europa N.V.

Model:

iR1510
iR1530
iR1570F

Ref No.:

iR1200S-011 Rev. 1
(F1-T01-0L6-10005-02)

Date:

26-11-04

Location:

Control panel

Subject:

Points to note for servicing in association with changes of LCD control panel and controller PCB

Detail:

The LCD control panel and the controller PCB are changed for reasons of procurement. After these changes, the two parts are not compatible in combination of the old and new parts. This bulletin is prepared to inform the points to note for servicing.

Service Work:

Both the old and new parts of the LCD and the controller PCB are stocked as service parts. When replacing the LCD or the controller PCB, be sure to check if it is the old type or the new type (a part number label is affixed on the back of the new-type part as shown in the illustration below), and replace the old type with the old type, and the new type with the new type.

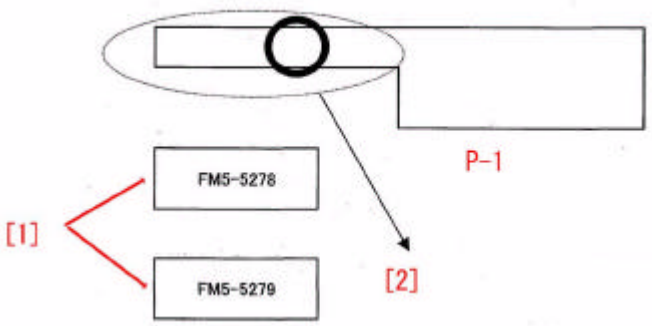

F-1

P-1: CONTROLLER PANEL PCB ASSEMBLY; Back surface

[1]: Part number label

[2]: Position where a part number label is affixed

Service Parts

No		Description	Part number	Qty	I.C.	PC
1	OLD	CONTROL PANEL PCB ASSEMBLY	FG6-8804-000	1	N	130
	NEW	CONTROL PANEL PCB ASSEMBLY	FM5-5278-000	1	N	
2	OLD	CONTROL PANEL PCB ASSEMBLY	FG6-8805-000	1	N	130
	NEW	CONTROL PANEL PCB ASSEMBLY	FM5-5279-000	1	N	
3	OLD	LCD CONTROL PANEL UNIT	FH6-0813-000	1	N	130
	NEW	LCD CONTROL PANEL UNIT	FH6-0846-000	1	N	

Affected Machines:

iR1510 EUR	JQG00241 and later	iR1510 FRN	JRC00353 and later
iR1510 EUR	JRD00097 and later	iR1510 ITA	JRF00057 and later
iR1510 EUR	JQH00105 and later		
iR1530 EUR	JRL00465 and later	iR1530 FRN	JRP00409 and later
iR1530 GER	JRW00497 and later	iR1530 ITA	JRX00017 and later
iR1530 GER	JRM00113 and later		
iR1570F GER	JSM00473 and later	iR1570F ITA	JSN00027 and later
iR1570F UK	JFK00209 and later	iR1570F EUR	JSE00509 and later