

(4) Removal of the Drive Cable

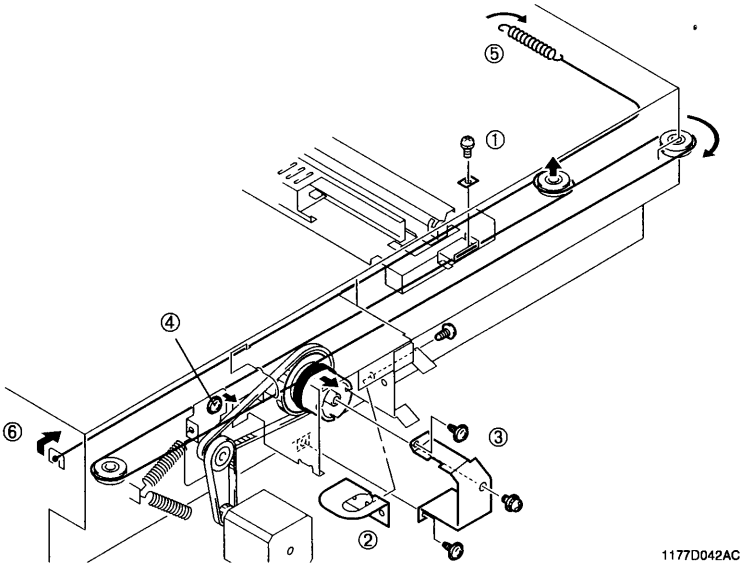

(5) Winding of the Drive Cable

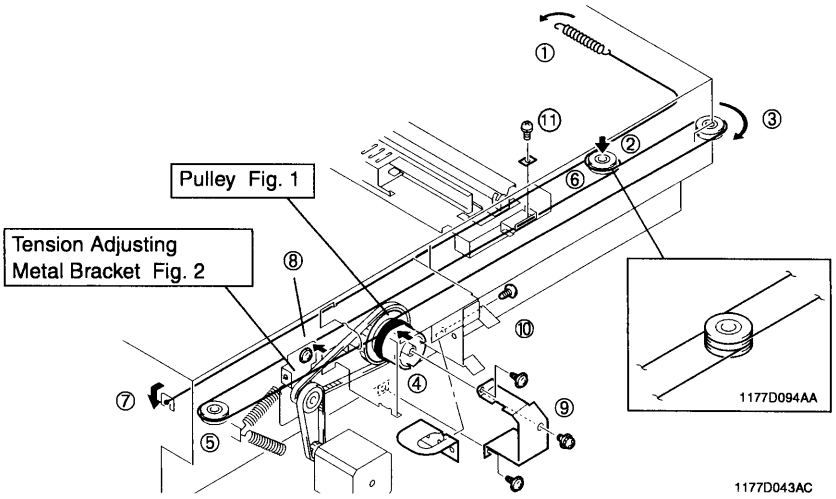

NOTE

Start winding the Scanner Drive Cable with the spring end. (When winding the cable, ensure that the cable has no slack.)

To hook the bead, pinch the cable with lineman's pliers and try to hook it while turning the pulley counterclockwise.