
SERVICE BULLETIN

☐ PROBLEM	○ FUNCTION	○ SAFETY
	○ SERVICEABILITY	○ OTHERS
■ OTHERS	○ PERFORMANCE	○ CORRECTION
	○ SAFETY REGULATION	● OTHERS

MODEL NAME : Di620
MODEL CODE : 1155
NO. : 028C
DATE : 990304
SUBJECT : SOFTWARE PROGRAM FOR IC21B ON PWB-B CHANGE

The software program for IC21B (01, 02) on PWB-B has been modified so that the words meaning “50 sheets” have been deleted from the message, in all languages, that warns the operator that the number of copies that can be stapled has been exceeded. The reason for this modification is as follows: Though the maximum number of copies that can be stapled in the Staple mode is 50, the copier gives a message on the Touch Panel that states something like “capacity (50 sheets)” or “Maximum····50 sheets” even when the number of sheets to be stapled is less than 50 depending on the combination of functions with Folding mode.

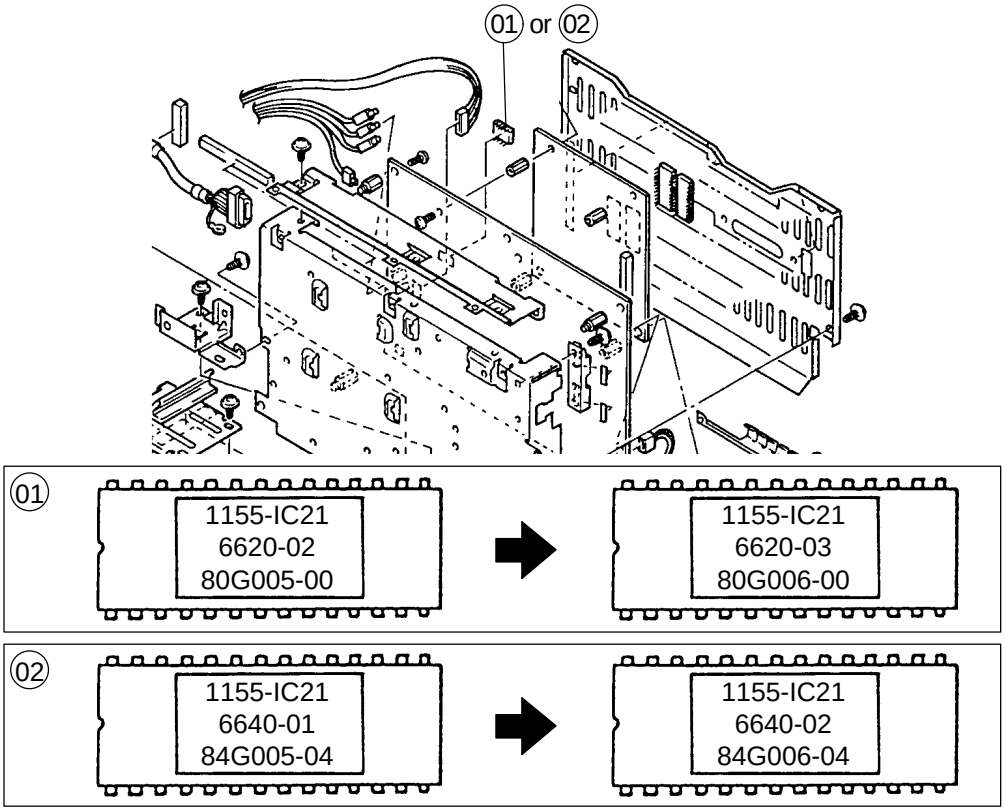

∗The following modification was implemented on/around July 1998 production.
The effective Se/No. was not confirmed.

NO.	BEFORE MODI. F-IND	BEFORE MODI. PART NO.	AFTER MODI. PART NO.	AFTER MODI. F-IND	PART NAME	QTY →	QTY I	SE/NO.	AREA
01	36-03AA	1155-6620-02	1155-6620-03	36-03AB	IC	1	1 Y	∗	0715
02	36-03BA	1155-6640-01	1155-6640-02	36-03BB	IC	1	1 Y	∗	2713