

1136P11DAA

4. On the Control Panel, press the Stop Key, Multi-Copy Key 0, Stop Key and Multi-Copy Key 1, in that order. The copier enters the Tech. Rep. Program mode.
5. Press Multi-Copy Key 1, Stop key and then Start key to enter the Adjustment Mode.

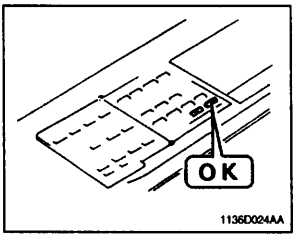

1136D024AA

6. Press the OK key (supplementary panel) repeatedly until the Display Panel shows the message " Feed Direction Mag. Ratio: (A 3)".
7. Note the value shown under the message and then press the Clear key to clear the current setting.
8. Using the Multi-Copy keys, increase or decrease the value with respect to the noted value for the correct magnification:

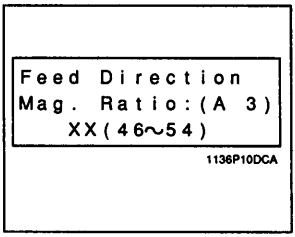

1136P10DCA

Adjustment procedure

When the copy of dimension A (300 mm) is:
298.5 mm or less: increase the value.
301.5 mm or more: decrease the value.

9. Press the Panel Reset key to return to the initial copy mode.
10. Make copies of the chart in the enlargement and reduction modes and verify that dimension A on the copies is within tolerance.

NOTE

In the enlargement mode, only half of dimension A of the scale on chart GTC-001 can be measured; hence, the measurement of 300 ±1.5 mm in the table.