6. Other Adjustments


) Focus-Positioning of the Scanner and Mirrors Carriage

Requirement


With the Scanner positioned in place on the copier upper frame, there should be no gap between one end of the Scanner/Carriage Positioning jig and the Scanner and between the other end of the jig and the Mirrors Carriage. The space between the Scanner and Mirrors Carriage = 83.5 mm

Important


This adjustment should be performed with the Scanner loosely attached to the Scanner Drive Cable by slightly loosening the screw on the Scanner Drive Cable Holding Bracket.

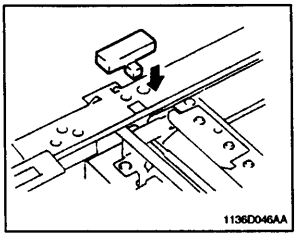


1. Align the rectangular hole in the upper copier frame with the U groove in the Scanner. Insert the Scanner Positioning jig.

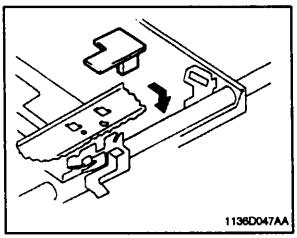

2. Install the Scanner/Carriage Positioning jig between the Scanner and the Mirrors Carriage.

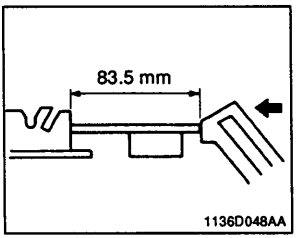

3. Press the Mirrors Carriage in the direction of the arrow.
4. Verify that both ends of the Scanner/Carriage Positioning jig have no gap.

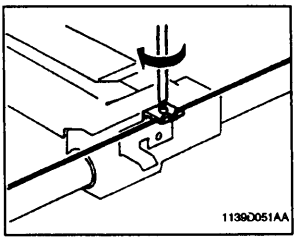

5. Tighten the screw on the Scanner Drive Wire Holding Bracket.