


4-1. Installation of Plug-in Counter (Option) Mounting Bracket

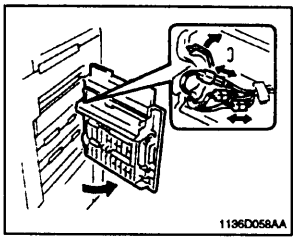


1. Open the Right Cover.
2. Remove the harness from the Wire Saddle.
3. Unplug three CN connectors, 2P, 3P and 3P.

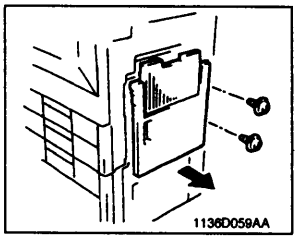


4. Remove the Right Cover by removing two screws.

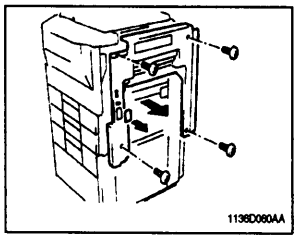

5. Remove the Counter Cover.
6. Remove the four screws from the Right Cover and then the cover.

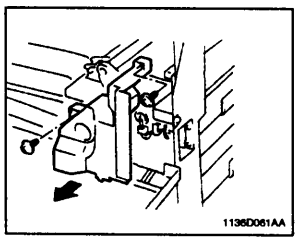

7. Remove the PC Unit.
8. Remove the B Board Protection Cover by first removing two screws.

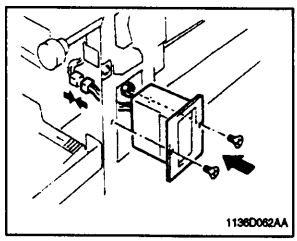

9. Connect the Plug-in Counter Connector.
10. Secure the Plug-in Counter Mounting Bracket with two screws.