
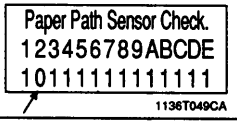

Symptom	Step	Check Item	Result	Action
	4	Check 2nd Drawer Paper Take-Up Sensor PC57 as follows. (See p. T-7.)		
		1) Select the function "Paper Path Sensor" and check to see if the data for sensor code 2 is set to "1."  1136T048CA 2) Move the actuator with a sheet of paper to block PC57.	NO	• Check the actuator for operation. • Check PC57.
		3) Has the data for 2 changed from "1" to "0"?  1136T049CA	NO	Replace PC57.
			YES	Replace PWB-A.
	5	Check Paper Transport Clutch CL1 for operation as follows. (See p. T-3, 4.) 1) Port: P7-4 2) Select the function "Port."		
		3) Is the data for P7-4 set to "1"?  1136T050AA	NO	Replace PWB-A.
		4) Does CL1 operate when the data for P7-4 is changed from "1" to "0"? (Check for the sound of operation.)	NO	Perform step 6.
	6	Does the malfunction code "C0324" appear when the function "Control Board" of "I/O Check" of the Tech. Rep. mode is run?	YES	Replace PWB-A.
			NO	Replace CL1.