◆ PF-102 Take-Up Misfeed Clearing Procedure

Symptom	Step	Check Item	Result	Action
• Paper is not taken up at all. • Paper is stationary before 3rd Drawer Paper Take-Up Sensor PC21.	1	Does the paper being used meet product specifications?	NO	Instruct the user to use the paper that meets product specifications.
	2	Is the paper curled, wavy, or damp?	YES	Change the paper. Instruct the user in how to store the paper.
	3	Is 3rd Drawer Paper Take-Up Motor M22 turning when the Start Key is pressed?	NO	First replace PF-102 PWB-A, then replace EP2050 PWB-A if necessary. Check M22.
			YES	Check for possible overload.
	4	Is the Paper Take-Up Roll or Separator Roll deformed, worn, or dirty with paper dust?	YES	Clean or replace the Paper Take-Up or Separator Roll.
• Paper is stationary before the Vertical Transport Rollers.	1	Check 3rd Drawer Paper Take-Up Sensor PC21 as follows. (See p. T-7.)		
		1) Select the function "Paper Path Sensor" and check to see if the data for sensor code 3 is set to "1." 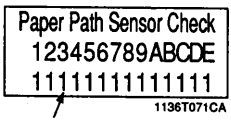 1136T071CA 2) Move the actuator with a sheet of paper to block PC21.	NO	• Check the actuator for operation. • Check PC21.
		3) Has the data for 3 changed from "1" to "0"? 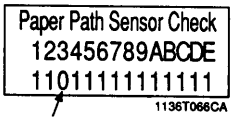 1136T066CA	NO	Replace PC21.
			YES	First replace PF-102 PWB-A, then replace EP2050 PWB-A if necessary.