* C004A, C004b

Step	Check Item	Result	Action
1	Perform the following steps to check if M5 turns when the Start Key is pressed. (See p. T-3, 4) 1) Port: P16-4 2) Select the function "Port."		
	3) Is the data for P16-4 set to "1"?  1136T105AA	NO	Replace PWB-A.
	4) Does M5 turn when the data for P16-4 is changed from "1" to "0"?	YES	Perform step 3.
2	Perform the following steps to check the input signal when M5 is stationary (Original Glass Cooling Fan Motor Lock signal). (See p. T-3, 4) 1) Port: P8-6		
	2) Select the function "Port." Is the data for P8-6 set to "H"? 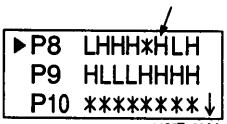 1136T106AA	NO	Replace PWB-A.
		YES	Replace M5.
3	Does M5 make unusual noise when turning?	YES	Check the fan for possible overload.