* C0990, C0991

Step	Check Item	Result	Action
1	Is C0991 being shown?	YES	Perform step 3.
2	Slide out the 3rd Drawer and check PC19 as follows. (See p. T-5, 6.) 1) Port: P37-5 2) Select the function "Port."		
	3) Is the data for P37-5 set to "H"? 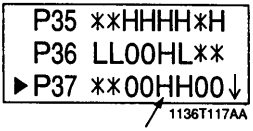 1136T117AA	NO	Check the Pressure Release mechanism of the Paper Take-Up/Feed Roll Assy. Check PC19.
		YES	First replace PF-102 PWB-A, then replace EP2050 PWB-A if necessary.
3	Move the PC19 actuator to block PC19 and check PC19 as follows. (See p. T-5, 6.) 1) Port: P37-5 2) Select the function "Port."		
	3) Is the data for P37-5 set to "L"? 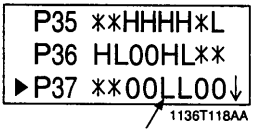 1136T118AA	NO	Check the Pressure Release mechanism of the Paper Take-Up/Feed Roll Assy. Replace PC19.
		YES	First replace PF-102 PWB-A, then replace EP2050 PWB-A if necessary.