Step	Check Item	Result	Action
4	Slide out the 3rd Drawer and check PC1 with no paper on the Shift Tray. (See p. T-5, 6.) 1) Port: P35-3 2) Select the function "Port."		
	3) Is the data for P35-3 set to "H"? 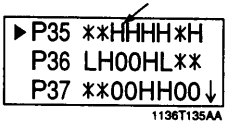 1136T135AA 4) Load the Shift Tray with paper.	NO	Check PWB-E and flat cable. Check PC1.
	5) Select "Port" again.  1136T136CA		
	6) Show the data for P35-3. Has the data changed from "H" to "L"?  1136T137AA	NO	Check PWB-H and flat cable. Replace PC1.
		YES	First replace PF-102 PWB-A, then replace EP2050 PWB-A if necessary.