RN SERIES TECHNICAL BULLETIN

Data Category	☐ Field Modification	■ Trouble-Shooting	☐ General Information	☐ Safety Advice

DISTRIBUTED TO : All Distributors

DATE : 22 March, 2001

MODEL : All "RN" models

ISSUE NO. : RNT-003

Our Ref.: C1-1653

Proceeding Grade
- ☐ Action ASAP
- ☐ Action as given below
- ■ Action if required
- ☐ Refer in need

Parts Compatibility
- ☐ Compatible
- ☐ Conditionally Compatible
- ☐ Not Compatible
- ■ Old Obsolete

Handling of Modified Parts
- ☐ Free of Charge
- ☐ Conditionally Chargeable
- ■ Chargeable

SUBJECT: 021-18202-204 Cutter Sheet

Brief:
The Cutter Sheet is redesigned for smooth master feeding.

Reason:
The previous Cutter Sheet tends to obstruct master feeding, expecially when the leading edge of the master is strongly curled. The leading edge of the master, during the master setting operation, cannot reach the Master Positioning Sensor, and master feed error "A01-201" appears.

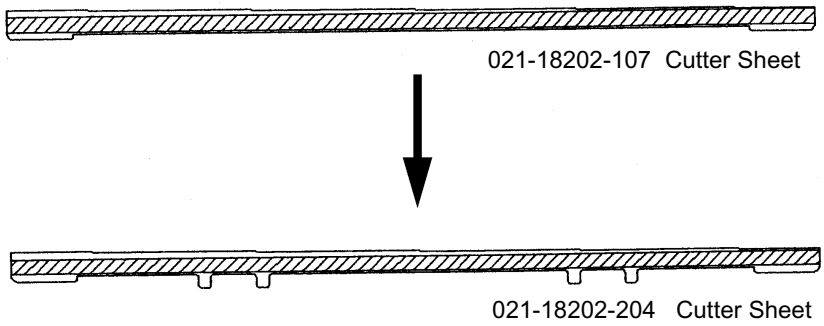

021-18202-107 Cutter Sheet

Newly-registered Part
021-18202-204 Cutter Sheet

021-18202-204 Cutter Sheet

Please refrain from ordering this part yet, as the part has not come into our stock yet. We will inform you when ready.

Application Serial No.

RN2130UI 85130968	RN2100EP 85150478	RN2050AW 85250242
RN2030UI 85221684	RN2000EP 85200320	RN2130AS 85140082
RN2000UI 85430001	RN2150EP 85080110	RN2030AS 85140245
RN2150UP 85070011	RN2050EP 85270099	RN2180C 85420031
RN2050UP 85280041	RN2150AN 85110011	RN2080C 85410092
RN2150EN 85090001	RN2050AN 85240097	
RN2050EN 85260001	RN2150AW 85100099	

Attached :