RN SERIES TECHNICAL BULLETIN

Data Category	☐ Field Modification	■ Trouble-Shooting	☐ General Information	☐ Safety Advice

DISTRIBUTED TO : All Distributors

DATE : 12 April, 2001

MODEL : All "RN" models

ISSUE NO. : RNT-010

Our Ref.: AC1-1690, AC1-1692, AC1-1693

Proceeding Grade
- ☐ Action ASAP
- ☐ Action as given below
- ■ Action if required
- ☐ Refer in need

Parts Compatibility
- ☐ Compatible
- ☐ Conditionally Compatible
- ☐ Not Compatible
- ■ Old Obsolete

Handling of Modified Parts
- ☐ Free of Charge
- ☐ Conditionally Chargeable
- ■ Chargeable

SUBJECT: 021-12102-305 Arm; Separator
021-12112-009 Lever; Separator
021-12113-005 Adj. Plate; Separator

Brief:
The "Lever; Separator" was changed from plastic material to metal.
At the same time, "Arm; Separator" and "Adj. Plate; Separator" is modified to be stronger.

Reason:
The plastic "Lever; Separator" had tendency to deform in time, due to its material. The deformation may cause the position of the Separator to change, and make the tip of the Separator to touch the Drum.

Newly-registered Part
021-12102-305 Arm; Separator
021-12112-009 Lever; Separator
021-12113-005 Adj. Plate; Separator

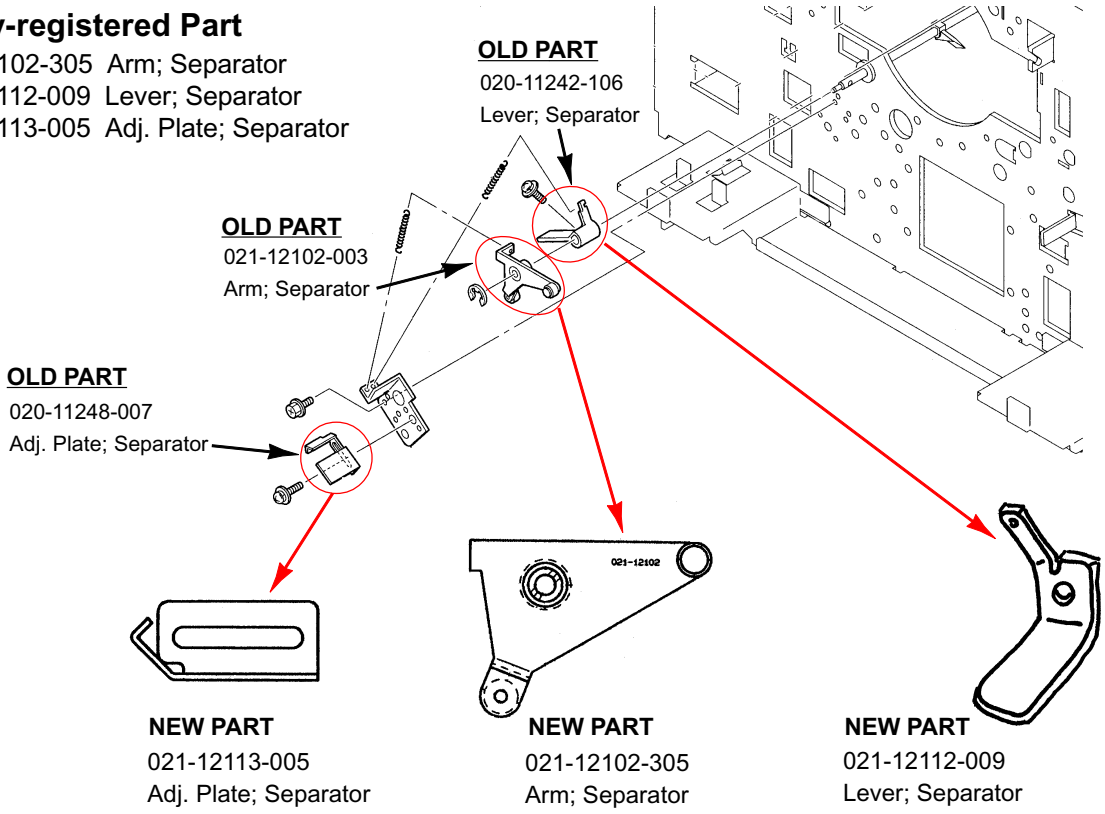

Please refrain from ordering this part yet, as the part has not come into our stock yet. We will inform you when ready.

RN SERIES TECHNICAL BULLETIN

ISSUE NO.: RNT-010

Application Serial No.

RN2130UI 85131220	RN2100EP 85150647	RN2050AW 85250357
RN2030UI 85221754	RN2000EP 85200468	RN2130AS 85140145
RN2000UI 85430555	RN2150EP 85080187	RN2030AS 85210255
RN2150UP 85070016	RN2050EP 85270167	RN2180C 85420047
RN2050UP 85280126	RN2150AN 85110021	RN2080C 85410138
RN2150EN 85090001	RN2050AN 85240191	
RN2050EN 85260001	RN2150AW 85100190	