RN SERIES TECHNICAL BULLETIN

Data Category	☐ Field Modification	■ Trouble-Shooting	☐ General Information	☐ Safety Advice

DISTRIBUTED TO : All Distributors

DATE : 13 April, 2001

MODEL : All "RN" models

ISSUE NO. : RNT-014

Our Ref.: C1-1669

Proceeding Grade
- ☐ Action ASAP
- ☐ Action as given below
- ■ Action if required
- ☐ Refer in need

Parts Compatibility
- ☐ Compatible
- ☐ Conditionally Compatible
- ☐ Not Compatible
- ■ Old Obsolete

Handling of Modified Parts
- ☐ Free of Charge
- ☐ Conditionally Chargeable
- ■ Chargeable

SUBJECT: 021-19055-205 Bracket; Safety SW Ass'y

Brief:
The bent portion of the part, to act as a stopper against "Bottom Bracket; M.-Disposal Gate Housing" is made longer.

Reason:
Above portion of the "Bracket; Safety SW Ass'y" had a possibility of riding on top of the "Bottom Bracket; M.-Disposal Gate Housing".
When that occurs, the two parts lock with each other, and the Disposal Box Safety Switch stays activated even when the Master Disposal Box is removed.
The panel displays a message either "C03-308" or "C03-313" after emptying the full Master Disposal Box.
The symptom is exactly the same as that explained on our RN technical bulletin issue **No.RNT-006**, only the cause is different.

Modification:
The bent portion of the part, to act as a stopper against "Bottom Bracket; M.-Disposal Gate Housing", is made longer, from 15 millimeters on the old part to 19.5 millimeters on the new part. An extension of 4.5 millimeters.

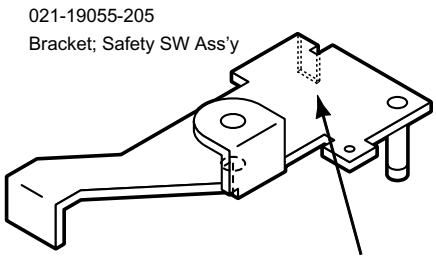

This bent-down portion of the metal sheet is extended 4.5 millimeters.
Old part number 021-19055-108 was 15 mm in length.
The new part number 021-19055-205 is 19.5 mm in length.

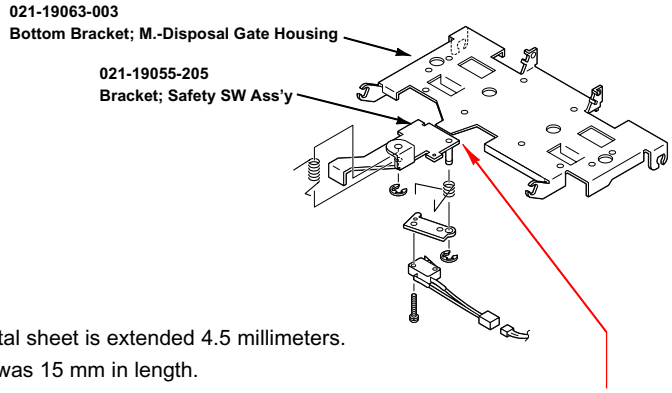

"Bracket; Safety SW Ass'y" had a possibility of riding on top of the "Bottom Bracket; M.-Disposal Gate Housing".

Application Serial No.

RN2130UI 85131273	RN2100EP 85150812	RN2050AW 85250377
RN2030UI 85221754	RN2000EP 85200685	RN2130AS 85140145
RN2000UI 85430900	RN2150EP 85080275	RN2030AS 85210255
RN2150UP 85070016	RN2050EP 85270228	RN2180C 85420076
RN2050UP 85280051	RN2150AN 85110033	RN2080C 85410180
RN2150EN 85090001	RN2050AN 85240208	
RN2050EN 85260001	RN2150AW 85100197	