
6) C0200: Corona Malfunctions

Relevant Electrical Parts	
• High Voltage Unit HV1	• Master Board PWB-A

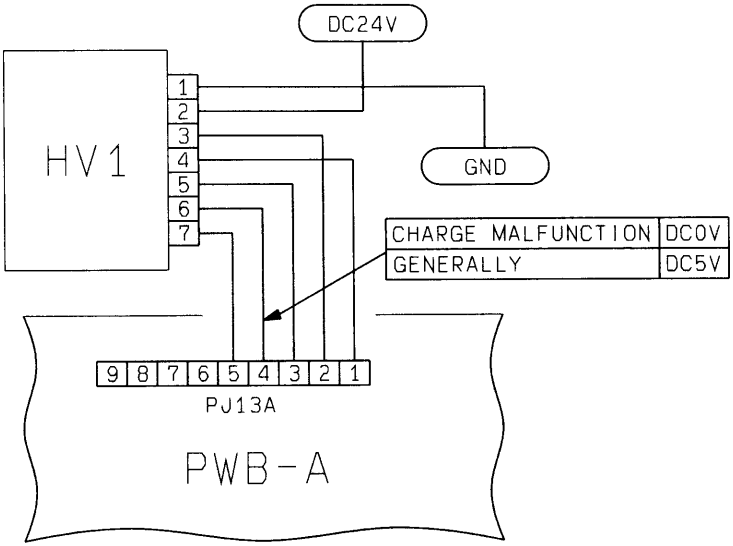

1156C10TAA

Step	Check Item	Result	Action
1	Is "C0200" displayed even when the PC Drum Charge Corona and Image Transfer/Paper Separator Coronas are removed?	YES	Go to step 4.
2	Is "C0200" displayed when the PC Drum Charge Corona is installed?	YES	Clean or change the PC Drum Charge Corona.
3	Is "C0200" displayed when the Image Transfer/Paper Separator Coronas unit is installed?	YES	Clean or change the Image Transfer/ Paper Separator Coronas.
4	Is "C0200" displayed even when the HV1 connector is unplugged?	YES	Change PWB-A.
		NO	Change HV1.